

Job Information

Job #: 95054 Date: December 31,

2018

Priority: — Authorized OT: No Authorized by:

Customer Information

Name: Delta Plastics Reason:

Contact: Motor#: PO#:

Application: – Special notes:

Name Plate Information

Manufacturer: Siemens Enclosure: Totally Enclosed Enclosure Type image

Fan Cooled

Serial#: UC1012/078856701 Model#: 1LG6220-4MA64-Z

Service Factor: Frame:

Horsepower/kW: 42.5 Rated RPM: 1770

Rated Amps: 66 Rated Voltage: 460

Phase: 3 Cycles: 60

No

Nameplate DE ODE F1 F2 Top



Special design:







Mechanical Inspection

Inspect bolt holes and fasteners. Validate correct fasteners.

Does the shaft turn freely?:

Contaminant(s): None

Shaft rotation: Bi-directional Contaminant(s) Amt: None

Shaft grounding device

present?:

No

Type of grounding device: None

Shaft runout(TIR-Inbound): .001

Bearings DE: Worn Bearings DE make: FAG

Insulated: No Bearing DE Size: Nu213

Bearings ODE: Worn Bearings ODE make: FAG

Bearing Type: Ball Bearing ODE Size: 6213/C3

Bearings Retainer: Yes Thermal Protection: Yes

Retainer condition: Good Thermal Protection Type: —

Bearing Type Image



Bearing Make Image



Bearing Retainer Image Thermal Protection



Lubrication Type: Grease Thermal Protection device DE: —

Lubrication brand inbound: Mobile Polyrex EM Thermal Protection device ODE: —

Lubrication brand outbound: Mobile Polyrex EM

Grease Amt DE: Full Grease Cond. DE: Hard

Grease Amt ODE: Full Grease Cond. ODE: Hard

Seals DE type: N/A

Seals DE size:

Seals DE (inbound) condition:

Seals ODE type: N/A

Seals ODE size:

Seals ODE (inbound) condition


:

Shaft damage cause: None Shaft Image:





Brg. Image:

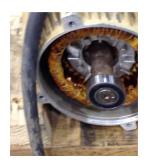

Water jacket: N/A Fan: Ok Frame cond.: Good





Motor Mount Position: Horizontal/Foot mount Endbell type: Single piece

Missing parts? Endbell Image:

✓ J-Box cover ☐ O-rings ☐ J-Box

☐ HH cover ☐ Glands ☐ None





Other missing parts



Air Gap Meaurements (N/A on Single Piece Endbell)

Does Air Gap Meet Customer or EASA spec(<10% variation)?

DE @ 0 ODE @ 0 -

DE @ 90 ODE @ 90

DE @ 180 ODE @ 180

DE @ 270 ODE @ 270

AC Electrical Inspection

Number of leads: 6 Terminal Markings:

Length of leads: REF: NEMA Stds. MG 1-2009, Rev. 1-2010, 2.41-Terminal

Markings Identified By Color:

Size of leads: 1-Blue 5-Black P1-No color assigned

2-White 6-No color assigned P2-Brown

3-Orange 7-No color assigned

Lead condition: Good 4-Yellow 8-Red

Connections As Received: Lug type:

Lug size:

Lug Condition:

Lug Attachment: Acceptable

Good

Terminal



Lugs





AC Electrical Inspection (Continued)

Rotor Type: Cast Aluminum

Rotor

Rotor Condition:

Ok

Num rotor bars:

Num broken bars:

Rotor Test Results

Visual: Pass Growler: Pass Single phase: Pass

Stator type: Factory If other, stator type:

Stator condition: Ok If other, stator condition:

Failure location: Other If other, stator failure:

Stator Image:



Fax 901-873-5301

Good

Hi-pot incoming:



AC Electrical Inspection (Continued)

Winding color: Like new Winding image Winding Thermal Protection: Yes

Winding condition: Solid

Winding Thermal ____ Protection DE:

Winding Thermal ____ Protection ODE:

Stator test results: Salvageable



Megs incoming: Good Surge incoming:

Winding Resistance Incoming

Phases A to B Phases B to C Phases C to A Resistive imbalance

Good

Incoming

Leads/jumpers: Ok

If other, leads/jumpers:

Mechanical Inspection

Inspect bolt holes and fasteners. Validate correct fasteners.

Shaft Condition: Good Bearings Retainer: Yes

Type of grounding device: Bearing DE Size:

Shaft runout(TIR-Inbound): Bearing ODE Size:

Retainer condition: Good

Phone 901-873-5300

Fax 901-873-5301



Seals DE condition: None Brg. Seats DE: Good

Seals DE type: N/A If DE undersized, amt.:

Seals DE size: Brg. Seats ODE: Good

Seals DE (inbound) condition: If ODE undersized, amt.:

Seals ODE condition: None Shaft damage: OK

Seals ODE type: N/A

Seals ODE size:

Bushings/sleeves DE: Ok

Seals ODE (inbound) condition : Bushings/sleeves ODE: Ok

Endbell fits/damage: Good Foot/Flange condition: Ok

Endbell DE size: 4.7253 Foot flatness: Pass

Endbell DE insulated?: No

Does Air Gap Meet Customer or EASA spec(<10%

variation)?

Endbell ODE insulated?: No

Endbell ODE size:

4.7253



Conclusion

Component Failure

Bearing required replacing

Cause of Failure

Customer requests recondition of motor

Comments

All machine fits check good.

Service Tech name: Terrence Holland

Service Tech signature:

Ten Hell