

### **Job Information**

Job #:	95215				Date:	February 7, 2019
Priority:	_	Authorized OT:	No	Authorized by:		

### **Customer Information**

Name:	Enterprise Products		Reason:	
Contact:		Motor#:		PO#:
Application:	_	Special notes:		

### **Name Plate Information**

Manufacturer:		Enclosure :	Open Drop Proof (ODP)
Serial#:		Model#:	6949666-001-AJT8
Service Factor:	1.00	Frame:	X0215TY
Horsepower/kW:	8Hp	Rated RPM:	3510
Rated Amps:	10.2	Rated Voltage:	460
Phase:	3	Cycles:	60
Special design:	No		

### Enclosure Type image



Nameplate

DE

ODE

F1

F2









Тор

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



### **Mechanical Inspection**

### Inspect bolt holes and fasteners. Validate correct fasteners.

Does the shaft turn freely?:	No	Contaminant(s):	None
Shaft rotation:	Bi-directional	Contaminant(s) Amt:	None
Shaft grounding device present?:	No	Contaminant Image:	
Type of grounding device:			C
Shaft runout(TIR-Inbound):			

Bearings DE:	Worn	Bearings DE make:	FAG
Insulated:	No	Bearing DE Size:	6306 2Z
Bearings ODE:	Worn	Bearings ODE make:	FAG
Bearing Type:	Ball	Bearing ODE Size:	6206 2Z
Bearings Retainer:	Yes	Thermal Protection:	Yes
Retainer condition:	_	Thermal Protection Type:	_

#### Bearing Type Image



Bearing Make Image



# **Bearing Retainer Image**

### **Thermal Protection**

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



# **Mechanical Inspection (Continued)**

Lubrication Type:	Grease	Thermal Protection device DE:	_
Lubrication brand inbound:	Mobile Polyrex EM	Thermal Protection device ODE:	_
Lubrication brand outbound:	Mobile Polyrex EM		
Grease Amt DE:	Full	Grease Cond. DE:	Charred
Grease Amt ODE:	Full	Grease Cond. ODE:	Charred
Seals DE type:	Isolators	Seals Image:	
Seals DE size:	JM 6162-LUP-2		1 CO
Seals DE (inbound) condition :	Worn		· · · · · · · · · · · · · · · · · · ·
Seals ODE type:	N/A		
Seals ODE size:			
Seals ODE (inbound) condition :			
Shaft damage cause:	None	Shaft Image:	



VEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



### **Mechanical Inspection (Continued)**

Brg. Image:



#### Water jacket: N/A

#### Fan:

N/A

Frame cond.: Good



#### Motor Mount Position: Horizontal/Foot mount Endbell type: Missing parts? Endbell Image: J-Box cover O-rings J-Box

None

Other missing parts

HH cover

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301

CENTRAL ARKANSAS 6812 Lindsey Rd. Little Rock, AR 72206 Phone 501-375-9178 Fax 501-375-4254

Glands

Single piece











### **Mechanical Inspection (Continued)**

Air Gap Meaurements (N/A on Singl	Does Air Gap Meet Customer or EASA spec(<10% variation)?	
DE @ 0	ODE @ 0	_
DE @ 90	ODE @ 90	
DE @ 180	ODE @ 180	
DE @ 270	ODE @ 270	


### **AC Electrical Inspection**

Number of leads:	3	Terminal Markings	:	
Length of leads:	33"	REF: NEMA St Markings Ident	ds. MG 1-2009, Rev. 1- ified By Color:	2010, 2.41-Terminal
Size of leads:		1-Blue 2-White 3-Orange	5-Black 6-No color assigned 7-No color assigned	P1-No color assigned P2-Brown
Lead condition:	Good	4-Yellow	8-Red	
Lug type:		Connections As R	leceived:	
Lug Condition:	Good		Terminal	Lugs
Lug size:				
Lug Attachment:	Acceptable			

WEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



### **AC Electrical Inspection (Continued)**

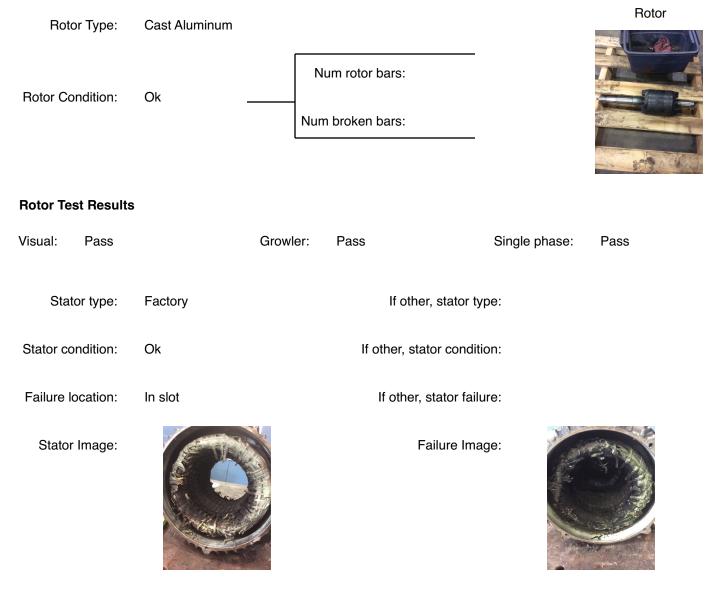

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



### **AC Electrical Inspection (Continued)**

Winding color:	Dull black	Winding	g image	Winding Therma	I Protection:	Yes
Winding condition :	Solid					
Winding Thermal Protection DE:	-					
Winding Thermal Protection ODE:	_					
Stator test results:	Rewind					
Megs incoming: Go	ood	Surge incoming:	Good	Hi-pot in	coming: G	Good
Winding Resistance Inc	coming					
Phase	es A to B	Phases B to C	Phase	es C to A	Resistive iml	balance
Incoming						
Leads/jumpe	ers: Ok					
If other, leads/jumpe	ers:					

# **Mechanical Inspection**

Inspect bolt holes and fasteners. Validate correct fasteners.

Shaft Condition:	Good	Bearings Retainer:	Yes
Type of grounding device:		Bearing DE Size:	6306 2Z
Shaft runout(TIR-Inbound):		Bearing ODE Size:	6206 2Z

Retainer condition: Good

- - - -

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



# **Mechanical Inspection (Continued)**

Seals DE condition :	Worn	Brg. Seats DE:	Good
Seals DE type:	N/A	If DE undersized, amt.:	
Seals DE size:		Brg. Seats ODE:	Good
Seals DE (inbound) condition :		If ODE undersized, amt.:	
Seals ODE condition :	Worn	Shaft damage:	ОК
Seals ODE type:	N/A		
Seals ODE size:		Bushings/sleeves DE:	Ok
Seals ODE (inbound) condition :		Bushings/sleeves ODE:	Ok
Endbell fits/damage:	Good	Foot/Flange condition:	Ok
Endbell DE size:	2.8348	Foot flatness:	Pass
Endbell DE insulated?:	No	Does Air Gap Meet Cu	stomer or EASA spec(<10%
Endbell ODE size:	2.4413	variation)?	
Endbell ODE insulated?:	No	_	

VEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



### Conclusion

#### **Component Failure**

Windings

#### **Cause of Failure**

Failure in slot

#### Comments

Rotor has chunks blown off and needs to be replaced.

Service Tech name: Terre

Terrence Holland

Service Tech signature:

Joll-

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301