

Job Information

Job #:	95223				Date:	February 11, 2019
Priority:	_	Authorized OT:	No	Authorized by:		

Customer Information

Name:	Mohawk		Reason:	
Contact:		Motor#:		PO#:
Application:	_	Special notes:		

Name Plate Information

Manufacturer:	TOSHIBA	Enclosure :	Open Drop Proof (ODP)
Serial#:	08020055	Model#:	5YT56DQF3BMK
Service Factor:	1.15	Frame:	254T
Horsepower/kW:	7.5	Rated RPM:	1165
Rated Amps:	10.5	Rated Voltage:	460
Phase:	3	Cycles:	60
Special design:	No		

Enclosure Type image



Nameplate

DE

ODE

F1

F2















WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection

Inspect bolt holes and fasteners. Validate correct fasteners.

Does the shaft turn freely?:	No	Contaminant(s):	None
Shaft rotation:	_	Contaminant(s) Amt:	None
Shaft grounding device present?:	No		
Type of grounding device:			

Shaft runout(TIR-Inbound):

Bearings DE:	Worn	Bearings DE make:	Koyo
Insulated:	No	Bearing DE Size:	6309
Bearings ODE:	Worn	Bearings ODE make:	Other
Bearing Type:	Ball	Bearing ODE Size:	6208
Bearings Retainer:	Yes	Thermal Protection:	Yes
Retainer condition:	_	Thermal Protection Type:	_

Bearing Type Image



WEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301 Bearing Make Image



CENTRAL ARKANSAS 6812 Lindsey Rd. Little Rock, AR 72206 Phone 501-375-9178 Fax 501-375-4254

Bearing Retainer Image



Thermal Protection





Mechanical Inspection (Continued)

Lubrication Type:	Grease	Thermal Protection device DE:	_
Lubrication brand inbound:	Unknown	Thermal Protection device ODE:	_
Lubrication brand outbound:	Unknown		
Grease Amt DE:	Full	Grease Cond. DE:	Hard
Grease Amt ODE:	0	Grease Cond. ODE:	Other
Seals DE type:	N/A		
Seals DE size:			
Seals DE (inbound) condition :			
Seals ODE type:	N/A		
Seals ODE size:			
Seals ODE (inbound) condition			
Shaft damage cause:	None	Shaft Image:	6



VEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection (Continued)

Brg. Image:



Bushings/sleeves image:



Water jacket:	N/A	Fan:	N/A	Fr

Frame cond.: Good



Motor Mount Position: Horizontal/Foot mount Endbell type: Missing parts? Endbell Image: J-Box cover O-rings J-Box **N**one HH cover Glands Other missing parts

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301

CENTRAL ARKANSAS 6812 Lindsey Rd. Little Rock, AR 72206 Phone 501-375-9178 Fax 501-375-4254

Single piece





Mechanical Inspection (Continued)

Air Gap Meaurements (N/A on Single Pie	Does Air Gap Meet Customer or EASA spec(<10% variation)?	
DE @ 0	ODE @ 0	_
DE @ 90	ODE @ 90	
DE @ 180	ODE @ 180	
DE @ 270	ODE @ 270	


AC Electrical Inspection

Number of leads:	3	Terminal Markings:		
Length of leads:		REF: NEMA Std Markings Identifi	s. MG 1-2009, Rev. 1- ed By Color:	2010, 2.41-Terminal
Size of leads:		1-Blue 2-White 3-Orange	5-Black 6-No color assigned 7-No color assigned	P1-No color assigned P2-Brown
Lead condition:	Good	4-Yellow	8-Red	
Lug type:		Connections As Re	ceived:	
Lug Condition:	_		Terminal	Lugs
Lug size:			Not	Not
Lug Attachment:	_		Not ailable	Not Available

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



AC Electrical Inspection (Continued)

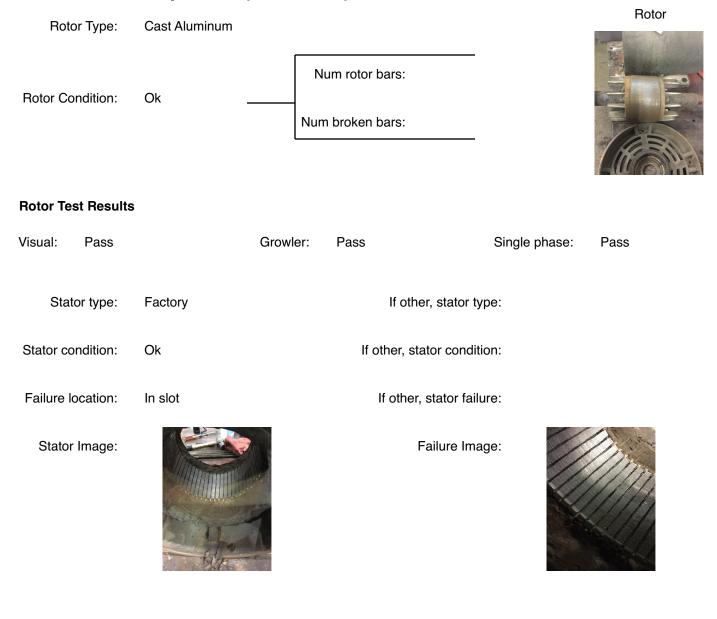

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



AC Electrical Inspection (Continued)

Winding color:	Painted	Winding	image \	Winding Therma	I Protection	: Yes	
Winding condition :	Solid						
Winding Thermal Protection DE:	_						
Winding Thermal Protection ODE:	_		AND A				
Stator test results:	Salvageable						
Megs incoming: 0	Good	Surge incoming:	Good	Hi-pot in	coming:	Good	
Winding Resistance I	ncoming						
Pha	ses A to B	Phases B to C	Phases	C to A	Resistive i	mbalance	
Incoming 1.3	29	1.330	1.329		0.0		
Leads/jum	oers: Ok						
If other, leads/jum	pers:						

Mechanical Inspection

Inspect bolt holes and fasteners. Validate correct fasteners.

Shaft Condition:	Damaged	Bearings Retainer:	Yes
Type of grounding device:		Bearing DE Size:	6309
Shaft runout(TIR-Inbound):		Bearing ODE Size:	6208

Retainer condition:

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301 CENTRAL ARKANSAS 6812 Lindsey Rd. Little Rock, AR 72206 Phone 501-375-9178 Fax 501-375-4254



Mechanical Inspection (Continued)

Seals DE condition :	None	Brg. Seats DE:	Good
Seals DE type:	N/A	If DE undersized, amt.:	
Seals DE size:		Brg. Seats ODE:	Good
Seals DE (inbound) condition :		If ODE undersized, amt.:	1.5472 Bad
Seals ODE condition :	None	Shaft damage:	Salvageable
Seals ODE type:	N/A		
Seals ODE size:		Bushings/sleeves DE:	Ok
Seals ODE (inbound) condition :		Bushings/sleeves ODE:	Ok
Endbell fits/damage:	Good	Foot/Flange condition:	Ok
Endbell DE size:	3.9378	Foot flatness:	Pass
Endbell DE insulated?:	No		stomer or EASA spec(<10%
Endbell ODE size:	3.2386 Bad	variation)?	
Endbell ODE insulated?:	No		

VEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Conclusion

Component Failure

Cause of Failure

Comments

Ode bearing fits are bad. Failure due to lubrications end bell and shaft bearing fits are bad

Service Tech name: R

Robert Wiley

Service Tech signature:

Jorg Willor

WEST TENNESSEE 7030 Ryburn Drive

 7030 Ryburn Drive
 681;

 Millington, TN 38053
 Littl

 Phone 901-873-5300
 Pho

 Fax 901-873-5301
 Fax