

Job Information

Job #:	95291				Date:	March 4, 2019
Priority:	_	Authorized OT:	No	Authorized by:		

Customer Information

Name:	Almatis		Reason:	
Contact:		Motor#:		PO#:
Application:	_	Special notes:		

Name Plate Information

Manufacturer:	US	Enclosure :	Open Drop Proof (ODP)	Enclosure Type image
Serial#:	H0150525LH	Model#:	BF77A	
Service Factor:	1.15	Frame:	H4444TPA	
Horsepower/kW:	150	Rated RPM:	1775	
Rated Amps:	174	Rated Voltage:	460	
Phase:	3	Cycles:	60	
Special design:	No			

Nameplate

DE

ODE

F1

F2





Тор

WEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection

Inspect bolt holes and fasteners. Validate correct fasteners.

Does the shaft turn freely?:	Yes	Contaminant(s): None
Shaft rotation:	CCW	Contaminant(s) Amt: None
Shaft grounding device present?:	No	Contaminant Image:
Type of grounding device:		Not Available

Shaft runout(TIR-Inbound):

Bearings DE:	Worn	Bearings DE make:	SKF
Insulated:	No	Bearing DE Size:	6215
Bearings ODE:	Worn	Bearings ODE make:	FAG
Bearing Type:	Ball	Bearing ODE Size:	7322
Bearings Retainer:	Yes	Thermal Protection:	Yes
Retainer condition:	_	Thermal Protection Type:	_

Bearing Type Image



WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301 Bearing Make Image



CENTRAL ARKANSAS 6812 Lindsey Rd. Little Rock, AR 72206 Phone 501-375-9178 Fax 501-375-4254

Bearing Retainer Image



Thermal Protection





Mechanical Inspection (Continued)

Lubrication Type:	Oil	Thermal Protection device DE:	_
Lubrication brand inbound:	Mobile Polyrex EM	Thermal Protection device ODE:	_
Lubrication brand outbound:	Mobile Polyrex EM		
Grease Amt DE:	Full	Grease Cond. DE:	Watery
Grease Amt ODE:	Full	Grease Cond. ODE:	Watery
Seals DE type:	N/A		
Seals DE size:			
Seals DE (inbound) condition :			
Seals ODE type:	N/A		
Seals ODE size:			
Seals ODE (inbound) condition			
Shaft damage cause:	None	Shaft Image:	



VEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Frame cond.:

Mechanical Inspection (Continued)

Brg. Image:



Bushings/sleeves image:



Water jacket: N/A



Endbell Image:

Ok

Fan:



Good

Motor Mount Position:

Horizontal/Foot mount

Endbell type:

Single piece

Missing parts?

1	Dave	

J-Box cover

HH cover

Glands

O-rings

None

J-Box





Other missing parts

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection (Continued)


Air Gap Meaurements (N/A on Single	Does Air Gap Meet Customer or EASA spec(<10% variation)?	
DE @ 0	ODE @ 0	_
DE @ 90	ODE @ 90	
DE @ 180	ODE @ 180	
DE @ 270	ODE @ 270	

AC Electrical Inspection

Number of leads:	6	Terminal Markings:	123 789	
Length of leads:		REF: NEMA Stds. Markings Identifie		2010, 2.41-Terminal
Size of leads:		1-Blue 2-White 3-Orange	5-Black 6-No color assigned 7-No color assigned	P1-No color assigned P2-Brown
Lead condition:	Good	4-Yellow	8-Red	
Lug type:		Connections As Reco	eived: 17 28 39	
Lug Condition:	Good	Τε	erminal	Lugs
Lug size:		١	Not	
Lug Attachment:	_		ailable	



AC Electrical Inspection (Continued)

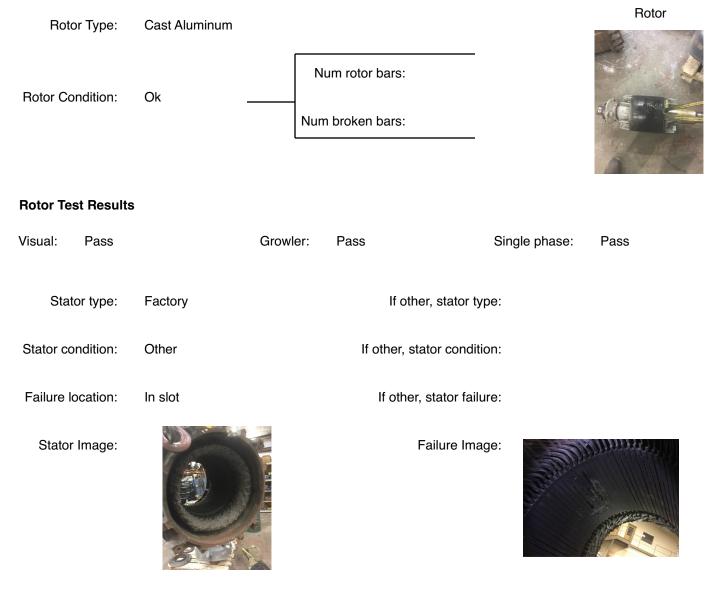

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



AC Electrical Inspection (Continued)

Win	ding color:	Like new	Winding	g image	Winding Thermal	I Protection:	No
Winding	condition :	Solid				Ν	lot
	ig Thermal ection DE:	_					lot lable
	ng Thermal ction ODE:	_					
Stator te	est results:	Rewind					
Megs inco	oming: Ba	ad	Surge incoming:	Bad	Hi-pot ind	coming: B	ad
Winding F	Resistance In	coming					
	Phas	es A to B	Phases B to C	Phase	es C to A	Resistive im	balance
Incoming	74.1	02	63.397	0.00		100	
	Leads/jump	ers: Ok		Lea	d jumper Image. :		
If othe	r, leads/jump	ers:					Not ailable

Mechanical Inspection

Inspect bolt holes and fasteners. Validate correct fasteners.

Shaft Condition:	Good	Bearings Retainer:	Yes
Type of grounding device:		Bearing DE Size:	6215
Shaft runout(TIR-Inbound):		Bearing ODE Size:	7322

Retainer condition:

7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301

Good



Mechanical Inspection (Continued)

Seals DE condition :	None	Brg. Seats DE:	Good
Seals DE type:	N/A	If DE undersized, amt.:	2.9537
Seals DE size:		Brg. Seats ODE:	Good
Seals DE (inbound) condition :		If ODE undersized, amt.:	4.3300
Seals ODE condition :	None	Shaft damage:	ОК
Seals ODE type:	N/A		
Seals ODE size:		Bushings/sleeves DE:	Ok
Seals ODE (inbound) condition :		Bushings/sleeves ODE:	Ok
Endbell fits/damage:	Good	Foot/Flange condition:	Ok
Endbell DE size:	5.1647 Bad	Foot flatness:	Pass
Endbell DE insulated?:	No		stomer or EASA spec(<10%
Endbell ODE size:	9.4500 Good	variation)?	
Endbell ODE insulated?:	No	—	

VEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Conclusion

Component Failure

Cause of Failure

Comments

DE Housing fit Bad DE Bearing corrosion pits as a result of oxidation of surfaces in the presence of moisture

Service Tech name: Rob

Robert Wiley

Service Tech signature:

ibers Diley

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300

Fax 901-873-5301