

MILLINGTON, TN LITTLE ROCK, AR

Job Information

| Job #: | 95813 | | | | Date: | July 29, 2019 |
|-----------|-------|----------------|----|----------------|-------|---------------|
| Priority: | _ | Authorized OT: | No | Authorized by: | | |

Customer Information

| Name: | Arauco | | Reason: | |
|--------------|--------|----------------|---------|------|
| Contact: | | Motor#: | | PO#: |
| Application: | _ | Special notes: | | |

Name Plate Information

| Manufacturer: | Reliance | Enclosure : | Open Drop Proof (ODP) |
|-----------------|----------|----------------|--------------------------|
| Serial#: | | Model#: | |
| Service Factor: | 1.15 | Frame: | 444T |
| Horsepower/kW: | 150 | Rated RPM: | 1780 |
| Rated Amps: | 175 | Rated Voltage: | 460 |
| Phase: | 3 | Cycles: | 60 |
| Special design: | No | | |

Enclosure Type image



Nameplate

DE

ODE

F1

F2





Тор













WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



MILLINGTON, TN LITTLE ROCK, AR

Mechanical Inspection

Inspect bolt holes and fasteners. Validate correct fasteners.

| Does the shaft turn freely?: | Yes | Contaminant(s): | None |
|----------------------------------|----------------|---------------------|------|
| Shaft rotation: | Bi-directional | Contaminant(s) Amt: | None |
| Shaft grounding device present?: | No | | |
| Type of grounding device: | | | |

Shaft runout(TIR-Inbound):

| Bearings DE: | Worn | Bearings DE make: | SKF |
|---------------------|------|--------------------------|------|
| Insulated: | No | Bearing DE Size: | 6318 |
| Bearings ODE: | Worn | Bearings ODE make: | SKF |
| Bearing Type: | Ball | Bearing ODE Size: | 6318 |
| Bearings Retainer: | Yes | Thermal Protection: | Yes |
| Retainer condition: | _ | Thermal Protection Type: | _ |

Bearing Type Image



Bearing Make Image



Bearing Retainer Image



Thermal Protection

Not Available

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection (Continued)

| Lubrication Type: | Grease | Thermal Protection device DE: | _ |
|--------------------------------|-------------------|--------------------------------|-----|
| Lubrication brand inbound: | Mobile Polyrex EM | Thermal Protection device ODE: | _ |
| Lubrication brand outbound: | Mobile Polyrex EM | | |
| Grease Amt DE: | Full | Grease Cond. DE: | New |
| Grease Amt ODE: | Full | Grease Cond. ODE: | New |
| | | | |
| Seals DE type: | N/A | | |
| Seals DE size: | | | |
| Seals DE (inbound) condition : | | | |
| | | | |
| Seals ODE type: | N/A | | |
| Seals ODE size: | | | |
| Seals ODE (inbound) condition | | | |
| Shaft damage cause: | None | Shaft Image: | |



VEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



MILLINGTON, TN LITTLE ROCK, AR

Mechanical Inspection (Continued)

Brg. Image:



Bushings/sleeves image:





Fan:

Frame cond.: Good



Not Available

Endbell Image:

Ok



Motor Mount Position: Horizontal/Foot mount

O-rings

Missing parts?

| I / | 1 | Dov | 001/01 |
|-----|---|-----|--------|

J-Box cover

HH cover

Glands

None

J-Box

Endbell type:

Single piece





Other missing parts

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection (Continued)

| Air Gap Meaurements (N/A on | Does Air Gap Meet Customer or EASA spec(<10% variation)? | |
|-----------------------------|--|---|
| DE @ 0 | ODE @ 0 | _ |
| DE @ 90 | ODE @ 90 | |
| DE @ 180 | ODE @ 180 | |
| DE @ 270 | ODE @ 270 | |

AC Electrical Inspection


| Number of leads: | 6 | Terminal Markings: | 1-3 | |
|------------------|---|--------------------------------------|---|----------------------------------|
| Length of leads: | | REF: NEMA Stds Markings Identifie | . MG 1-2009, Rev. 1- ed By Color: | 2010, 2.41-Terminal |
| Size of leads: | | 1-Blue 2-White 3-Orange | 5-Black 6-No color assigned 7-No color assigned | P1-No color assigned P2-Brown |
| Lead condition: | _ | 4-Yellow | 8-Red | |
| Lug type: | | Connections As Rec | eived: | |
| Lug Condition: | _ | Те | erminal | Lugs |
| Lug size: | | | | |
| Lug Attachment: | _ | | Not ailable | Not Available |

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



MILLINGTON, TN LITTLE ROCK, AR

AC Electrical Inspection (Continued)

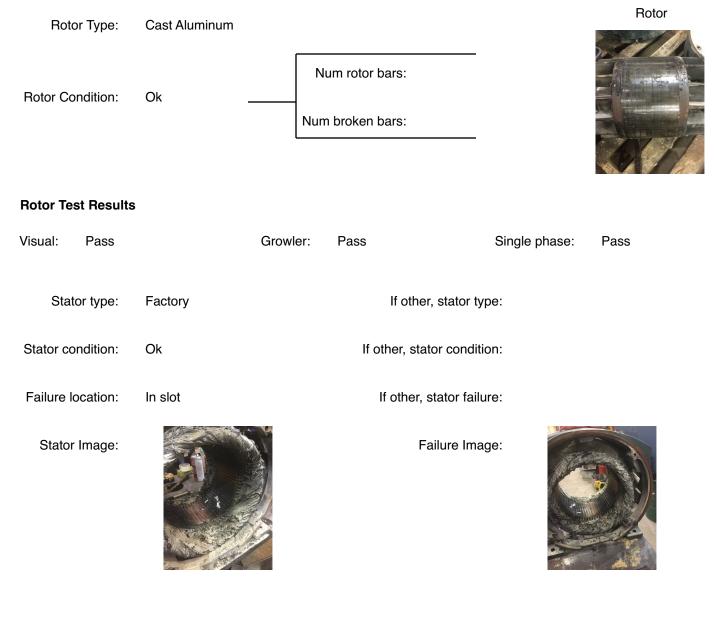

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



MILLINGTON, TN LITTLE ROCK, AR

AC Electrical Inspection (Continued)

| Winding color: | Dull black | Winding | g image | Winding Thermal | Protection: | Yes |
|------------------------------------|-------------|-----------------|---------|-------------------|--------------|----------------|
| Winding condition : | Charred | | | | Ν | lot |
| Winding Thermal Protection DE: | | Not Availab | | | | |
| Winding Thermal Protection ODE: | | | | | | |
| Stator test results: | Rewind | | | | | |
| Megs incoming: | Bad | Surge incoming: | Bad | Hi-pot inc | coming: | Bad |
| Winding Resistance | Incoming | | | | | |
| Ph | ases A to B | Phases B to C | Phase | es C to A | Resistive in | nbalance |
| Incoming 0. | .00 | 0.00 | 0.00 | | 0.00 | |
| Leads/jur | npers: Ok | | Lead | d jumper Image. : | | |
| If other, leads/jur | npers: | | | | Av | Not ailable |

Mechanical Inspection

Inspect bolt holes and fasteners. Validate correct fasteners.

| Shaft Condition: | Good | Bearings Retainer: | Yes |
|----------------------------|------|--------------------|------|
| Type of grounding device: | | Bearing DE Size: | 6318 |
| Shaft runout(TIR-Inbound): | | Bearing ODE Size: | 6318 |

Retainer condition:

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301 CENTRAL ARKANSAS 6812 Lindsey Rd. Little Rock, AR 72206 Phone 501-375-9178 Fax 501-375-4254



Mechanical Inspection (Continued)

| Seals DE condition : | Worn | Brg. Seats DE: | Good |
|---------------------------------|-------------|--------------------------|--------------------------|
| Seals DE type: | N/A | If DE undersized, amt.: | 3.5435 |
| Seals DE size: | | Brg. Seats ODE: | Good |
| Seals DE (inbound) condition : | | If ODE undersized, amt.: | 3.5434 |
| Seals ODE condition : | Worn | Shaft damage: | ОК |
| Seals ODE type: | N/A | | |
| Seals ODE size: | | Bushings/sleeves DE: | Ok |
| Seals ODE (inbound) condition : | | Bushings/sleeves ODE: | Ok |
| Endbell fits/damage: | Bad | Foot/Flange condition: | Ok |
| Endbell DE size: | 7.4831 | Foot flatness: | Pass |
| Endbell DE insulated?: | No | Does Air Gap Meet Cu | stomer or EASA spec(<10% |
| Endbell ODE size: | 7.4803 Good | variation)? | |
| Endbell ODE insulated?: | No | _ | |

VEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Conclusion

Component Failure

Cause of Failure

Single Phased

Comments

Found frosting in de bearing De bearing housing fit bad

Service Tech name:

Robert Wiley

Service Tech signature:

sits Willey

WEST TENNESSEE 7030 Ryburn Drive

7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301