

Job Information

Job #: 96308 Date: December 10,

2019

Priority: — Authorized OT: No Authorized by:

Customer Information

Name: Welspun Tubular Reason:

Contact: Motor#: PO#:

Application: – Special notes:

Name Plate Information

Serial#:

Manufacturer: Baldor Enclosure: Totally Enclosed Enclosure Type image

Fan Cooled

C0711260160 Model#:

Service Factor: 1.15 Frame: 445T

Horsepower/kW: 150 Rated RPM: 1780

Rated Amps: 168 Rated Voltage: 460

Phase: 3 Cycles: 60

No

Nameplate DE ODE F1 F2 Top



Special design:







WEST TENNESSEE



Mechanical Inspection

Inspect bolt holes and fasteners. Validate correct fasteners.

Does the shaft turn freely?: Yes Contaminant(s): None

Shaft rotation: Bi-directional Contaminant(s) Amt: None

Shaft grounding device

present?:

No

Type of grounding device:

Shaft runout(TIR-Inbound):

Bearings DE: Worn Bearings DE make: FAG

Insulated: No Bearing DE Size: 6319

Bearings ODE: Worn Bearings ODE make: FAG

Bearing Type: Ball Bearing ODE Size: 6314

Bearings Retainer: Yes Thermal Protection: No

Retainer condition: Good Thermal Protection Type: —

Bearing Type Image



Bearing Make Image



Bearing Retainer Image



Thermal Protection



Lubrication Type: Oil Thermal Protection device DE: -

Lubrication brand inbound: Mobile Polyrex EM Thermal Protection device ODE: —

Lubrication brand outbound: Mobile Polyrex EM

Grease Amt DE: Full Grease Cond. DE: Other

Grease Amt ODE: Full Grease Cond. ODE: Other

Seals DE type: N/A

Seals DE size:

Seals DE (inbound) condition:

Seals ODE type: N/A

Seals ODE size:

Seals ODE (inbound) condition

:

Shaft damage cause: None Shaft Image:





Brg. Image:



Water jacket: N/A Fan: Ok Frame cond.: Good



Endbell type: Single piece


Missing parts? Endbell Image:

☐ J-Box cover ☐ O-rings ☑ J-Box

☐ None

Horizontal/Foot mount

Glands

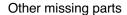

☐ HH cover

Motor Mount Position:







Air Gap Meaurements (N/A on Single Piece Endbell)

Does Air Gap Meet Customer or EASA spec(<10% variation)?

DE @ 0 ODE @ 0 —

DE @ 90 ODE @ 90

DE @ 180 ODE @ 180

DE @ 270 ODE @ 270

AC Electrical Inspection

Number of leads: 6 Terminal Markings:

Length of leads: 16 in REF: NEMA Stds. MG 1-2009, Rev. 1-2010, 2.41-Terminal

Markings Identified By Color:

Size of leads: 1-Blue 5-Black P1-No color assigned

2-White 6-No color assigned P2-Brown

3-Orange 7-No color assigned

Lead condition: Good 4-Yellow 8-Red

Lug type: NA Connections As Received:

Lug Condition: — Terminal Lugs

Lug size:

Lug Attachment: —

Fax 901-873-5301



AC Electrical Inspection (Continued)

Rotor Type: Cast Aluminum

Ok

Num rotor bars: 46

Num broken bars: 0

Rotor



Rotor Test Results

Rotor Condition:


Visual: Pass Growler: Pass Single phase: Pass

Stator type: Factory If other, stator type:

Stator condition: Ok If other, stator condition:

Failure location: In slot If other, stator failure:

Stator Image: Failure Image:

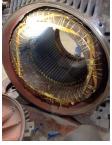





AC Electrical Inspection (Continued)

Winding color: Still has color Winding image Winding Thermal Protection: No

Winding condition: Solid

Winding Thermal ____ Protection DE:

Winding Thermal _____

Stator test results: Rewind

Megs incoming: Good Surge incoming: Good Hi-pot incoming: Good

Winding Resistance Incoming

Phases A to B Phases B to C Phases C to A Resistive imbalance

Incoming 0.00 0.00 0.00

Leads/jumpers: Ok Lead jumper Image. :

If other, leads/jumpers:

Mechanical Inspection

Inspect bolt holes and fasteners. Validate correct fasteners.

Shaft Condition: Good Bearings Retainer: Yes

Type of grounding device: Bearing DE Size: 6319

Shaft runout(TIR-Inbound): Bearing ODE Size: 6314

Retainer condition: Good

ax 901-873-5301



Seals DE condition: None Brg. Seats DE: Good

Seals DE type: N/A If DE undersized, amt.:

Seals DE size: Brg. Seats ODE: Good

Seals DE (inbound) condition: If ODE undersized, amt.:

Seals ODE condition: None Shaft damage: OK

Seals ODE type: N/A

Seals ODE size:

Bushings/sleeves DE: Ok

Seals ODE (inbound) condition : Bushings/sleeves ODE: Ok

Endbell fits/damage: Good Foot/Flange condition: Ok

Endbell DE size: 7.8759 Foot flatness: Pass

Endbell DE insulated?: -

Does Air Gap Meet Customer or EASA spec(<10%

variation)?

Endbell ODE insulated?: -

Endbell ODE size:

5.9053



Conclusion

Component Failure

Cause of Failure

Comments

Windings are blown in slot and both bearings show signs of contamination. Recommend rewind, new bearings and reconditioning

Mrt Celebres

Service Tech name: Chris Wiley

Service Tech signature: