

Job Information

Job #:	96674				Date:	March 18, 2020
Priority:	_	Authorized OT:	No	Authorized by:		

Customer Information

Name:	Reynolds Consumer Produ	lcts	Reason:	
Contact:		Motor#:		PO#:
Application:	_	Special notes:		

Name Plate Information

Manufacturer:	Marathon	Enclosure :	Totally Enclosed Non-Ventilated
Serial#:	M65075341-06/19-0 1	Model#:	
Service Factor:	1.15	Frame:	324TZ
Horsepower/kW:	25	Rated RPM:	1170
Rated Amps:	13	Rated Voltage:	230/460
Phase:	3	Cycles:	60
Special design:	No		

Enclosure Type image





DE

ODE

F1

F2

Тор







WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection

Inspect bolt holes and fasteners. Validate correct fasteners.

Does the shaft turn freely?:	Yes	Contaminant(s):	None
Shaft rotation:	Bi-directional	Contaminant(s) Amt:	None
Shaft grounding device present?:	Yes	Contaminant Image:	
Type of grounding device:	Brush		
Shaft runout(TIR-Inbound):			

Bearings DE:	Worn	Bearings DE make:	SKF
Insulated:	No	Bearing DE Size:	6312 2Z
Bearings ODE:	Worn	Bearings ODE make:	NSK
Bearing Type:	Ball	Bearing ODE Size:	6311 2Z
Bearings Retainer:	Yes	Thermal Protection:	Yes
Retainer condition:	_	Thermal Protection Type:	Thermocouple

Bearing Type Image



Bearing Make Image

Bearing Retainer Image

Thermal Protection



WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection (Continued)

Lubrication Type:	Oil	Thermal Protection device DE:	_
Lubrication brand inbound:	Unknown	Thermal Protection device ODE:	_
Lubrication brand outbound:	Unknown		
Grease Amt DE:	1/2	Grease Cond. DE:	New
Grease Amt ODE:	1/2	Grease Cond. ODE:	New
Seals DE type:	N/A		
Seals DE size:			
Seals DE (inbound) condition :			
Seals ODE type:	N/A		
Seals ODE size:			
Seals ODE (inbound) condition			
Shaft damage cause:	None	Shaft Image:	



VEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection (Continued)

Brg. Image:




Water jacket:	Ok	Fan:	Ok	Frame cond.:	Good

Motor Mount Position: Horizor

Horizontal/Foot mount

Endbell type: Sing

Single piece

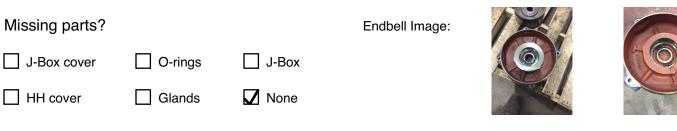

Other missing parts

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection (Continued)

Air Gap Meaurements (N/A on Single Piece Endbell)			Does Air Gap Meet Customer or EASA spec(<10% variation)?
	DE @ 0	ODE @ 0	_
	DE @ 90	ODE @ 90	
	DE @ 180	ODE @ 180	
	DE @ 270	ODE @ 270	

AC Electrical Inspection

Number of leads:	3	Terminal Markings:		
Length of leads:	8"	REF: NEMA Std Markings Identifi	s. MG 1-2009, Rev. 1- ied By Color:	2010, 2.41-Terminal
Size of leads:		1-Blue 2-White 3-Orange	5-Black 6-No color assigned 7-No color assigned	P1-No color assigned P2-Brown
Lead condition:	Good	4-Yellow	8-Red	
Lug type:		Connections As Re	ceived:	
Lug Condition:	_		Terminal	Lugs
Lug size:				Report of the second seco
Lug Attachment:	_			

WEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



AC Electrical Inspection (Continued)

Rotor Type:	Cast Aluminum		Rotor
Rotor Condition:	Ok Num rot	tor bars: en bars:	
Rotor Test Results			
Visual: Pass	Growler: Pas	s Single phase:	Pass
Stator type: Stator condition: Failure location:	Factory Ok Other	If other, stator type: If other, stator condition: If other, stator failure:	
Stator Image:			

VEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



AC Electrical Inspection (Continued)

Winding color:	Like new	Winding	image Windi	ng Thermal Protection	: Yes
Winding condition :	Solid	h			
Winding Thermal Protection DE:					
Winding Thermal Protection ODE:					
Stator test results:	Rewind				
Megs incoming:	Good	Surge incoming:	Good	Hi-pot incoming:	Good
Winding Resistance	Incoming				
Ph	ases A to B	Phases B to C	Phases C to	A Resistive	imbalance
Incoming					
Leads/jur	npers: Ok		Lead jump	er Image. :	
If other, leads/jur	npers:				
Mechanical In	-				B
Inspect bolt holes and	d fasteners. Valida	ate correct fasteners.			

Shaft Condition:	Good	Bearings Retainer:	Yes
Type of grounding device:	Brush	Bearing DE Size:	6312 2Z
Shaft runout(TIR-Inbound):		Bearing ODE Size:	6311 2Z

Retainer condition:

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301 CENTRAL ARKANSAS 6812 Lindsey Rd. Little Rock, AR 72206 Phone 501-375-9178 Fax 501-375-4254

_



Mechanical Inspection (Continued)

Seals DE condition :	None	Brg. Seats DE:	Good	
Seals DE type:	N/A	If DE undersized, amt.:		
Seals DE size:		Brg. Seats ODE:	Good	
Seals DE (inbound) condition :		If ODE undersized, amt.:		
Seals ODE condition :	None	Shaft damage:	ОК	
Seals ODE type:	N/A			
Seals ODE size:		Bushings/sleeves DE:	Ok	
Seals ODE (inbound) condition :		Bushings/sleeves ODE:	Ok	
Endbell fits/damage:	Good	Foot/Flange condition:	Ok	
Endbell DE size:		Foot flatness:	Pass	
Endbell DE insulated?:	No		Does Air Gap Meet Customer or EASA spec(<10% variation)?	
Endbell ODE size:	Good	variation)?		
Endbell ODE insulated?:	No			

VEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Conclusion

Component Failure

Bearings

Cause of Failure

Contaminated grease

Comments

Customer requests electrical and operational check of motor assembly and bearing change only

Service Tech name: Terrence Holland

Service Tech signature:

Hllm

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301