

Job Information

Job #:	96958				Date:	June 17, 2020
Priority:	_	Authorized OT:	No	Authorized by:		

Customer Information

Name:	Sage V Foods		Reason:	
Contact:		Motor#:		PO#:
Application:	_	Special notes:		

Name Plate Information

Manufacturer:	Baldor	Enclosure :	Totally Enclosed Fan Cooled
Serial#:	C1904260377	Model#:	
Service Factor:	1.15	Frame:	324TCZ
Horsepower/kW:	40	Rated RPM:	1775
Rated Amps:	96/48	Rated Voltage:	230/460
Phase:	3	Cycles:	60

Enclosure Type image



Nameplate

Special design:

DE

No

ODE

F1

F2

Тор





WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection

Inspect bolt holes and fasteners. Validate correct fasteners.

Does the shaft turn freely?:	No	Contaminant(s):	Water
Shaft rotation:	Bi-directional	Contaminant(s) Amt:	Other
Shaft grounding device present?:	No	Contaminant Image:	
Type of grounding device:			
Shaft runout(TIR-Inbound):			6110

Bearings DE:	Worn	Bearings DE make:	FAG
Insulated:	No	Bearing DE Size:	
Bearings ODE:	Worn	Bearings ODE make:	FAG
Bearing Type:	Ball	Bearing ODE Size:	
Bearings Retainer:	Yes	Thermal Protection:	No
Retainer condition:	Good	Thermal Protection Type:	_

Bearing Type Image



Bearing Make Image

WEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Bearing Retainer Image



Thermal Protection



Mechanical Inspection (Continued)

Lubrication Type:	Grease	Thermal Protection device DE:	_
Lubrication brand inbound:	Mobile Polyrex EM	Thermal Protection device ODE:	_
Lubrication brand outbound:	Mobile Polyrex EM		
Grease Amt DE:	Full	Grease Cond. DE:	Other
Grease Amt ODE:	Full	Grease Cond. ODE:	Other
Seals DE type:	N/A		
Seals DE size:			
Seals DE (inbound) condition :			
Seals ODE type:	N/A		
Seals ODE size:			
Seals ODE (inbound) condition :			
Shaft damage cause:	None	Shaft Image:	



VEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection (Continued)

Brg. Image:



Water jacket:	N/A		Fan:	Ok	Frame co	nd.: Good
			1 Miles			
Motor Mount Posi	tion: Horizontal/F	oot mount			Endbell type:	Single piece
Missing parts?	?			Endbell Image:		
J-Box cover	O-rings	J-Box				
HH cover	Glands	Vone				
Other missing pa	irts					

VEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection (Continued)

Air Gap Meaurements (N/A on Single Pie	Does Air Gap Meet Customer or EASA spec(<10% variation)?	
DE @ 0	ODE @ 0	_
DE @ 90	ODE @ 90	
DE @ 180	ODE @ 180	
DE @ 270	ODE @ 270	


AC Electrical Inspection

Number of leads:	9	Terminal Markings:				
Length of leads:	10in	REF: NEMA Stds. MG 1-2009, Rev. 1-2010, 2.41-Terminal Markings Identified By Color:				
Size of leads:		1-Blue 2-White 3-Orange	5-Black 6-No color assigned 7-No color assigned	P1-No color assigned P2-Brown		
Lead condition:	Good	4-Yellow	8-Red			
Lug type:		Connections As Re	eceived:			
Lug Condition:	-		Terminal	Lugs		
Lug size:						
Lug Attachment:	_					

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



AC Electrical Inspection (Continued)

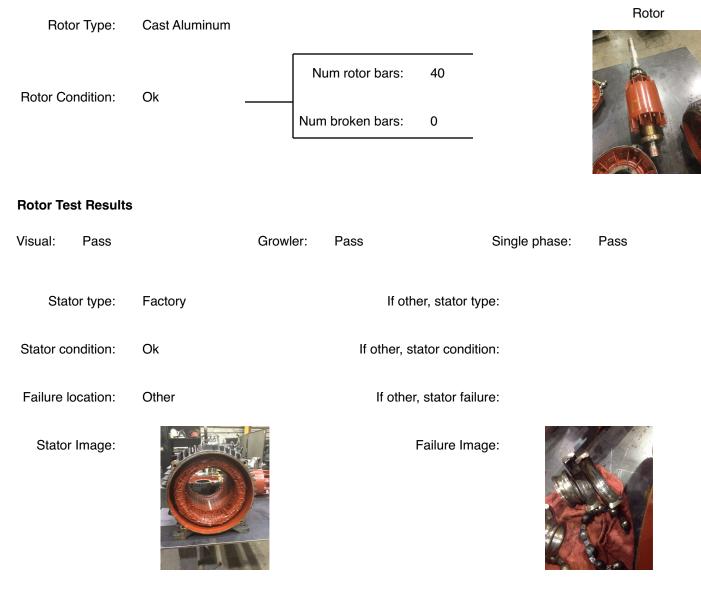

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



AC Electrical Inspection (Continued)

Winding colo	r: Painted	Winding	image Winding	Thermal Protection:	No	
Winding condition	: Solid					
Winding Therma Protection DE			C C C C C C C C C C C C C C C C C C C			
Winding Therma Protection ODE						
Stator test results	s: Salvageable)				
Megs incoming:	Good	Surge incoming:	Good	Hi-pot incoming: G	Good	
Winding Resistand	ce Incoming					
F	Phases A to B	Phases B to C	Phases C to A	Resistive im	balance	
Incoming	0.00	0.00	0.00			
Leads/ju If other, leads/ju			Lead jumper	Image. :	K	
Mechanical Inspection						
Inspect bolt holes a	nd fasteners. Valio	date correct fasteners.				
Shaft (Condition: Goo	od	Bearings Retaine	er: Yes		

Type of grounding device:

Shaft runout(TIR-Inbound):

Retainer condition:

: Good

Bearing DE Size: 6312 Bearing ODE Size: 6311

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection (Continued)

Seals DE condition :	None	Brg. Seats DE:	Good
Seals DE type:	N/A	If DE undersized, amt.:	
Seals DE size:		Brg. Seats ODE:	Good
Seals DE (inbound) condition :		If ODE undersized, amt.:	
Seals ODE condition :	None	Shaft damage:	ОК
Seals ODE type:	N/A		
Seals ODE size:		Bushings/sleeves DE:	Ok
Seals ODE (inbound) condition :		Bushings/sleeves ODE:	Ok
Endbell fits/damage:	Good	Foot/Flange condition:	Ok
Endbell DE size:	5.1183	Foot flatness:	Pass
Endbell DE insulated?:	_		stomer or EASA spec(<10%
Endbell ODE size:	ize: 4.7244 variation)?		
Endbell ODE insulated?:	_		

VEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Conclusion

Component Failure

Bearings failed

Cause of Failure

Signs of water contamination

Comments

Recommend new bearings and reconditioning

Service Tech name:

Chris Wiley

Service Tech signature:

Charg Ulleb

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301