

Job Information

Job #:	96985				Date:	June 23, 2020
Priority:	_	Authorized OT:	No	Authorized by:		

Customer Information

Name:	Huber		Reason:	
Contact:		Motor#:		PO#:
Application:	_	Special notes:		

Name Plate Information

Manufacturer:	U.S.	Enclosure :	Open Drop Proof (ODP)
Serial#:	X06-708258-0001- GT-01	Model#:	H100P3EB-C
Service Factor:	1.15	Frame:	444T
Horsepower/kW:	100	Rated RPM:	1185
Rated Amps:	248/124	Rated Voltage:	
Phase:	3	Cycles:	60
Special design:	No		

Enclosure Type image



Nameplate

DE

ODE

F1

F2

Тор







WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection

Inspect bolt holes and fasteners. Validate correct fasteners.

Does the shaft turn freely?:	Yes	Contaminant(s):	None
Shaft rotation:	Bi-directional	Contaminant(s) Amt:	None
Shaft grounding device present?:	No	Contaminant Image:	
Type of grounding device:			
Shaft runout(TIR-Inbound):			

Bearings DE:	Worn	Bearings DE make:	FAG
Insulated:	No	Bearing DE Size:	N318-J/C3
Bearings ODE:	Worn	Bearings ODE make:	FAG
Bearing Type:	Ball	Bearing ODE Size:	6313-J/C3
Bearings Retainer:	Yes	Thermal Protection:	Yes
Retainer condition:	Good	Thermal Protection Type:	_

Bearing Type Image



Bearing Make Image

Bearing Retainer Image

Thermal Protection

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301





Mechanical Inspection (Continued)

Lubrication Type:	Grease	Thermal Protection device DE:	_
Lubrication brand inbound:	Mobile Polyrex EM	Thermal Protection device ODE:	_
Lubrication brand outbound:	Mobile Polyrex EM		
Grease Amt DE:	Full	Grease Cond. DE:	New
Grease Amt ODE:	Full	Grease Cond. ODE:	New
Seals DE type:	N/A		
Seals DE size:			
Seals DE (inbound) condition :			
Seals ODE type:	N/A		
Seals ODE size:			
Seals ODE (inbound) condition			
Shaft damage cause:	None	Shaft Image:	



VEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection (Continued)

Brg. Image:



Bushings/sleeves image:



Water jacket: N/A

Fan: Ok



Endbell Image:

Frame cond.: Good



Motor Mount Position:

Horizontal/Foot mount

Endbell type:

Single piece

Missing parts?

HH cover

J-Box cover

O-rings Glands

None

J-Box





Other missing parts

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection (Continued)

Air Gap Meaurements (N/A on Singl	Does Air Gap Meet Customer or EASA spec(<10% variation)?	
DE @ 0	ODE @ 0	_
DE @ 90	ODE @ 90	
DE @ 180	ODE @ 180	
DE @ 270	ODE @ 270	


AC Electrical Inspection

Number of leads:	12	Terminal Markings	:	
Length of leads:	8"	REF: NEMA St Markings Ident	ds. MG 1-2009, Rev. 1- ified By Color:	2010, 2.41-Terminal
Size of leads:		1-Blue 2-White 3-Orange	5-Black 6-No color assigned 7-No color assigned	P1-No color assigned P2-Brown
Lead condition:	Good	4-Yellow	8-Red	
Lug type:		Connections As R	Received:	
Lug Condition:	Good		Terminal	Lugs
Lug size:				
Lug Attachment:	Acceptable			and a second sec

WEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



AC Electrical Inspection (Continued)

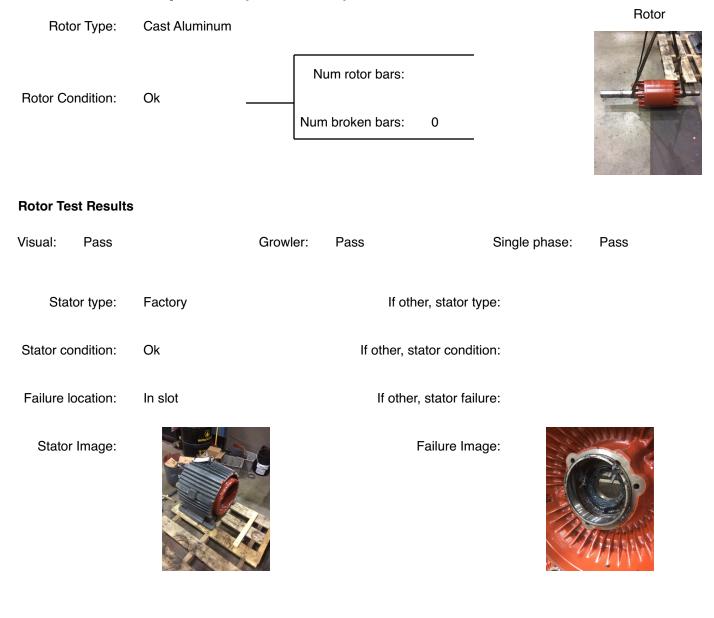

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



AC Electrical Inspection (Continued)

Winding color:	Painted	Winding	ı image	Winding Therm	al Protection	: No		
Winding condition :	Solid							
Winding Thermal Protection DE:	_							
Winding Thermal Protection ODE:	_							
Stator test results:	Salvageable							
Megs incoming: Go	ood	Surge incoming:	Good	Hi-pot	incoming:	Good		
Winding Resistance In	coming							
Phase	es A to B	Phases B to C	Phase	es C to A	Resistive i	mbalance		
Incoming								
Leads/jumpe	ers: Ok							
If other, leads/jumpe	ers:							

Mechanical Inspection

Inspect bolt holes and fasteners. Validate correct fasteners.

Shaft Condition:	Good	Bearings Retainer:	Yes
Type of grounding device:		Bearing DE Size:	N318-J/C3
Shaft runout(TIR-Inbound):		Bearing ODE Size:	6313 2Z

Retainer condition: (

: Good

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection (Continued)

Seals DE condition :	Worn	Brg. Seats DE:	Good
Seals DE type:	N/A	If DE undersized, amt.:	
Seals DE size:		Brg. Seats ODE:	Good
Seals DE (inbound) condition :		If ODE undersized, amt.:	
Seals ODE condition :	Worn	Shaft damage:	ОК
Seals ODE type:	N/A		
Seals ODE size:		Bushings/sleeves DE:	Ok
Seals ODE (inbound) condition :		Bushings/sleeves ODE:	Ok
Endbell fits/damage:	Good	Foot/Flange condition:	Ok
Endbell DE size:		Foot flatness:	Pass
Endbell DE insulated?:	_		stomer or EASA spec(<10%
Endbell ODE size:		variation)?	
Endbell ODE insulated?:	No		

VEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Conclusion

Component Failure

Bearings

Cause of Failure

Contaminated grease in both housings, and false brinelling in opposite drive end bearing.

Comments

Recommend replacing both bearings.

Service Tech name: **Terrence Holland**

Service Tech signature:

Enner Holland

WEST TENNESSEE 7030 Ryburn Drive

Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301