

Job Information

Job #: 96986 Date: June 24, 2020

Priority: — Authorized OT: No Authorized by:

Customer Information

Name: Johnson Controls Reason:

Contact: Motor#: PO#:

Application: – Special notes:

Name Plate Information

Manufacturer: Teco Enclosure: Totally Enclosed Enclosure Type image

Fan Cooled

Serial#: AQAC4B014-1 Model#:

Service Factor: Frame: 447TCZ

Horsepower/kW: 250 Rated RPM: 1782

Rated Amps: 560/280 Rated Voltage: 230/460

Phase: 3 Cycles: 60

No

Nameplate DE ODE F1 F2 Top



Special design:







Mechanical Inspection

Type of grounding device:

Shaft runout(TIR-Inbound):

Inspect bolt holes and fasteners. Validate correct fasteners.

Does the shaft turn freely?:

Contaminant(s): None

Shaft rotation: — Contaminant(s) Amt: None

Shaft grounding device No Contaminant Image:

present?:

Bearings DE: Worn Bearings DE make: FAG

Insulated: No Bearing DE Size:

Bearings ODE: Worn Bearings ODE make: FAG

Bearing Type: Ball Bearing ODE Size:

Bearings Retainer: Yes Thermal Protection: Yes

Retainer condition: — Thermal Protection Type: —

Bearing Type Image



Bearing Make Image



Bearing Retainer Image



Thermal Protection



Lubrication Type: Grease Thermal Protection device DE: Thermal Overloads

Lubrication brand inbound: Mobile Polyrex EM Thermal Protection device ODE: —

Lubrication brand outbound: Mobile Polyrex EM

Grease Amt DE: Full Grease Cond. DE: Watery

Grease Amt ODE: Full Grease Cond. ODE: Watery

Seals DE type: N/A

Seals DE size:

Seals DE (inbound) condition:

Seals ODE type: N/A

Seals ODE size:

Seals ODE (inbound) condition

:

Shaft damage cause: None Shaft Image:





Brg. Image:




Water jacket: N/A Fan: Ok Frame cond.: Good



Motor Mount Position: Horizontal/Foot mount Endbell type: Single piece

Missing parts? Endbell Image:

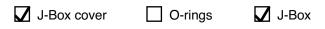



Other missing parts







Air Gap Meaurements (N/A on Single Piece Endbell)

Does Air Gap Meet Customer or EASA spec(<10% variation)?

DE @ 0 ODE @ 0 —

DE @ 90 ODE @ 90

DE @ 180 ODE @ 180

DE @ 270 ODE @ 270

AC Electrical Inspection

Number of leads: 6 Terminal Markings:

Length of leads: 8" REF: NEMA Stds. MG 1-2009, Rev. 1-2010, 2.41-Terminal

Markings Identified By Color:

Size of leads: 1-Blue 5-Black P1-No color assigned

2-White 6-No color assigned P2-Brown

3-Orange 7-No color assigned

Lead condition: Good 4-Yellow 8-Red

Connections As Received: Lug type:

Lug Condition: Good Terminal Lugs

Lug size:

Lug Attachment: Acceptable



AC Electrical Inspection (Continued)

Rotor Type: Cast Aluminum

Ok

Num rotor bars:

Num broken bars: 0

Rotor



Rotor Test Results

Rotor Condition:

Visual: Pass Growler: Pass Single phase: Pass

Stator type: Factory If other, stator type:

Stator condition: Ok If other, stator condition:

Failure location: Other If other, stator failure:

Stator Image: Failure Image:







AC Electrical Inspection (Continued)

Winding color: Painted Winding image Winding Thermal Protection: Yes

Winding condition: Solid

Winding Thermal Protection DE:

Winding Thermal
Protection ODE:

Stator test results: Salvageable

Megs incoming: Good Surge incoming: Good Hi-pot incoming: Good

Winding Resistance Incoming

Phases A to B Phases B to C Phases C to A Resistive imbalance

Incoming

Leads/jumpers: Ok

If other, leads/jumpers:

Mechanical Inspection

Inspect bolt holes and fasteners. Validate correct fasteners.

Shaft Condition: Good Bearings Retainer: Yes

Type of grounding device: Bearing DE Size: 6320

Shaft runout(TIR-Inbound): .002 Bearing ODE Size: 6316

Retainer condition: Good

CENTRAL ARKANSAS



Seals DE condition: None Brg. Seats DE: Good

Seals DE type: N/A If DE undersized, amt.:

Seals DE size: Brg. Seats ODE: Good

Seals DE (inbound) condition: If ODE undersized, amt.:

Seals ODE condition: None Shaft damage: OK

Seals ODE type: N/A

Seals ODE size:

Bushings/sleeves DE: Ok

Seals ODE (inbound) condition : Bushings/sleeves ODE: Ok

Endbell fits/damage: Good Foot/Flange condition: Ok

Endbell DE size: 8.4649 Foot flatness: Pass

Endbell DE insulated?: No

Does Air Gap Meet Customer or EASA spec(<10%

variation)?

Endbell ODE insulated?: No

Endbell ODE size:

6.6930



Conclusion

Component Failure

Bearings

Cause of Failure

Excessive amounts of oil inside stator windings contaminated the grease inside the end bell housings causing premature bearing failure.

Tenence Holland

Comments

Service Tech name: Terrence Holland

Service Tech signature: