

Job Information

Job #:	97054				Date:	July 14, 2020
Priority:	_	Authorized OT:	No	Authorized by:		

Customer Information

Name:	Sage V Foods		Reason:	
Contact:		Motor#:		PO#:
Application:	_	Special notes:		

Name Plate Information

Manufacturer:	Baldor	Enclosure :	Totally Enclosed Non-Ventilated
Serial#:	C1810150237	Model#:	
Service Factor:	1.0	Frame:	284T
Horsepower/kW:	25	Rated RPM:	1775
Rated Amps:	62/31	Rated Voltage:	230/460
Phase:	3	Cycles:	60
Special design:	No		

Enclosure Type image



Nameplate

DE

ODE

F1

F2

Тор







VEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection

Inspect bolt holes and fasteners. Validate correct fasteners.

Does the shaft turn freely?:	Yes	Contaminant(s):	None
Shaft rotation:	Bi-directional	Contaminant(s) Amt:	None
Shaft grounding device present?:	No		
Type of grounding device:			

Shaft runout(TIR-Inbound):

Bearings DE:	Worn	Bearings DE make:	FAG
Insulated:	No	Bearing DE Size:	6311-2RS
Bearings ODE:	Worn	Bearings ODE make:	FAG
Bearing Type:	Ball	Bearing ODE Size:	6309-2RS
Bearings Retainer:	Yes	Thermal Protection:	No
Retainer condition:	Good	Thermal Protection Type:	_

Bearing Type Image



Bearing Make Image



WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301 CENTRAL ARKANSAS 6812 Lindsey Rd. Little Rock, AR 72206 Phone 501-375-9178 Fax 501-375-4254



Bearing Retainer Image

Thermal Protection



Mechanical Inspection (Continued)

Lubrication Type:	Grease	Thermal Protection device DE:	_
Lubrication brand inbound:	Mobile Polyrex EM	Thermal Protection device ODE:	_
Lubrication brand outbound:	Mobile Polyrex EM		
Grease Amt DE:	Full	Grease Cond. DE:	New
Grease Amt ODE:	Full	Grease Cond. ODE:	New
Seals DE type:	N/A		
Seals DE size:			
Seals DE (inbound) condition :			
Seals ODE type:	N/A		
Seals ODE size:			
Seals ODE (inbound) condition			
Shaft damage cause:	None	Shaft Image:	



VEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection (Continued)

Brg. Image:



Water jacket:	N/A	Fan:	N/A	Frame cond.:	Good

Horizontal/Foot mount

Endbell type:

Endbell Image:

Single piece

Missing parts? O-rings J-Box J-Box cover

Glands HH cover

None





Other missing parts

Motor Mount Position:

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection (Continued)

Air Gap Meaurements (N/A on Single Pie	Does Air Gap Meet Customer or EASA spec(<10% variation)?	
DE @ 0	ODE @ 0	_
DE @ 90	ODE @ 90	
DE @ 180	ODE @ 180	
DE @ 270	ODE @ 270	


AC Electrical Inspection

Number of leads:	9	Terminal Markings:		
Length of leads:	14in	REF: NEMA Sto Markings Identi	ds. MG 1-2009, Rev. 1- fied By Color:	2010, 2.41-Terminal
Size of leads:		1-Blue 2-White 3-Orange	5-Black 6-No color assigned 7-No color assigned	P1-No color assigned P2-Brown
Lead condition:	_	4-Yellow	8-Red	
Lug type:		Connections As R	eceived:	
Lug Condition:	_		Terminal	Lugs
Lug size:				
Lug Attachment:	_			

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



AC Electrical Inspection (Continued)

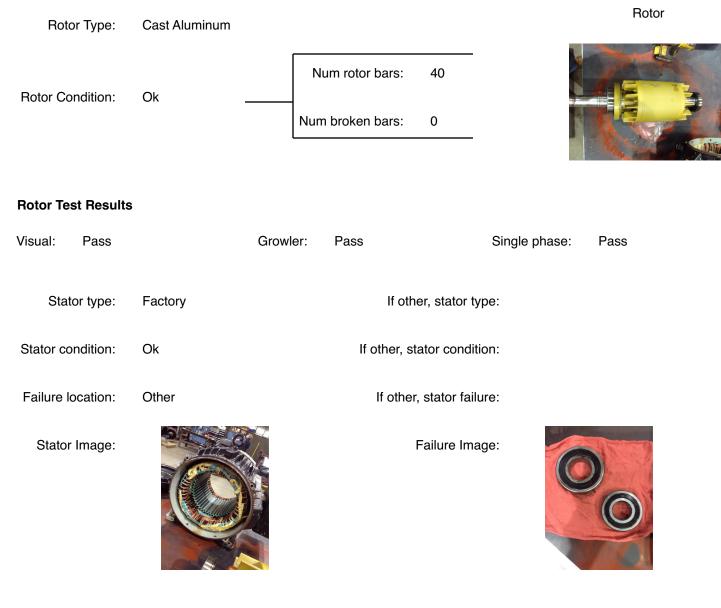

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300

Fax 901-873-5301



AC Electrical Inspection (Continued)

Winding color:	Like new	Winding	g image	Winding The	rmal Protectior	n: No
Winding condition :	Solid					
Winding Thermal Protection DE:	_					
Winding Thermal Protection ODE:	_		P			
Stator test results:	Salvageable					
Megs incoming: Go	bod	Surge incoming:	Good	Hi-pc	ot incoming:	Good
Winding Resistance In	coming					
Phase	es A to B	Phases B to C	Phase	es C to A	Resistive	imbalance
Incoming 0.00		0.00	0.00			
Leads/jumpe	ers: Ok		Lead	d jumper Imag	e. :	
If other, leads/jumpe	ers:					
Mechanical Ins	pection				2	
Inspect bolt holes and fa	asteners. Valida	te correct fasteners.				
Shaft Conc	dition: Good		Bearing	s Retainer:	Yes	
Type of grounding de	evice:		Bearir	ng DE Size:	6311	

Shaft runout(TIR-Inbound):

Retainer condition:

: Good

Bearing DE Size: 6311 Bearing ODE Size: 6309

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection (Continued)

Seals DE condition :	None	Brg. Seats DE:	Good
Seals DE type:	N/A	If DE undersized, amt.:	
Seals DE size:		Brg. Seats ODE:	Good
Seals DE (inbound) condition :		If ODE undersized, amt.:	
Seals ODE condition :	None	Shaft damage:	ОК
Seals ODE type:	N/A		
Seals ODE size:		Bushings/sleeves DE:	Ok
Seals ODE (inbound) condition :		Bushings/sleeves ODE:	Ok
Endbell fits/damage:	Good	Foot/Flange condition:	Ok
Endbell DE size:	4.7253	Foot flatness:	Pass
Endbell DE insulated?:	_		stomer or EASA spec(<10%
Endbell ODE size:	3.9381	variation)?	
Endbell ODE insulated?:	_		

VEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Conclusion

Component Failure

Bearings

Cause of Failure

Frosting

Comments

Recommend reconditioning, new bearings, and a aegis ring

Service Tech name: 0

Chris Wiley

Service Tech signature:

Chris hlour

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301