

Job Information

Job #:	97255				Date:	August 27, 2020
Priority:	_	Authorized OT:	No	Authorized by:		

Customer Information

Name:	Bemis		Reason:	
Contact:		Motor#:		PO#:
Application:	_	Special notes:		

Name Plate Information

Manufacturer:	Magnetek	Enclosure :	Totally Enclosed Fan Cooled
Serial#:	BN 09	Model#:	CAT#T348
Service Factor:	1.15	Frame:	215T
Horsepower/kW:	10	Rated RPM:	1740
Rated Amps:	26/13	Rated Voltage:	230/460
Phase:	3	Cycles:	60
Special design:	No		

Enclosure Type image



Nameplate

DE

ODE

F1

F2

Тор







WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection

Inspect bolt holes and fasteners. Validate correct fasteners.

Does the shaft turn freely?:	_	Contaminant(s):	None
Shaft rotation:	Bi-directional	Contaminant(s) Amt:	None
Shaft grounding device present?:	No		
Type of grounding device:			

Shaft runout(TIR-Inbound):

Bearings DE:	Worn	Bearings DE make:	SKF
Insulated:	No	Bearing DE Size:	6208
Bearings ODE:	Worn	Bearings ODE make:	SKF
Bearing Type:	Ball	Bearing ODE Size:	6207
Bearings Retainer:	Yes	Thermal Protection:	Yes
Retainer condition:	_	Thermal Protection Type:	_

Bearing Type Image



Bearing Make Image



WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301

CENTRAL ARKANSAS 6812 Lindsey Rd. Little Rock, AR 72206 Phone 501-375-9178 Fax 501-375-4254



Thermal Protection



Mechanical Inspection (Continued)

Lubrication Type:	Grease	Thermal Protection device DE:	_
Lubrication brand inbound:	Mobile Polyrex EM	Thermal Protection device ODE:	_
Lubrication brand outbound:	Mobile Polyrex EM		
Grease Amt DE:	Full	Grease Cond. DE:	Hard
Grease Amt ODE:	Full	Grease Cond. ODE:	Hard
Seals DE type:	Other	Seals Image:	
Seals DE size:	40*52*8		OF
Seals DE (inbound) condition :	Worn		
Seals ODE type:	Slinger		
Seals ODE size:			
Seals ODE (inbound) condition :			
Shaft damage cause:	None	Shaft Image:	S



VEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection (Continued)

Brg. Image:




Water jacket: N/A

Fan: Ok



Endbell Image:





Motor Mount Position: Ho

Horizontal/Foot mount

J-Box

None

O-rings

Glands

Endbell type:

Single piece

Other missing parts

Missing parts?

J-Box cover

HH cover

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection (Continued)

Air Gap Meaurements (N/A on Single Pie	Does Air Gap Meet Customer or EASA spec(<10% variation)?	
DE @ 0	ODE @ 0	_
DE @ 90	ODE @ 90	
DE @ 180	ODE @ 180	
DE @ 270	ODE @ 270	


AC Electrical Inspection

Number of leads:	9	Terminal Markings:		
Length of leads:	8"	REF: NEMA Sto Markings Identi	ds. MG 1-2009, Rev. 1- fied By Color:	2010, 2.41-Terminal
Size of leads:		1-Blue 2-White 3-Orange	5-Black 6-No color assigned 7-No color assigned	P1-No color assigned P2-Brown
Lead condition:	Good	4-Yellow	8-Red	
Lug type:		Connections As Re	eceived:	
Lug Condition:	_		Terminal	Lugs
Lug size:				
Lug Attachment:	_			

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



AC Electrical Inspection (Continued)

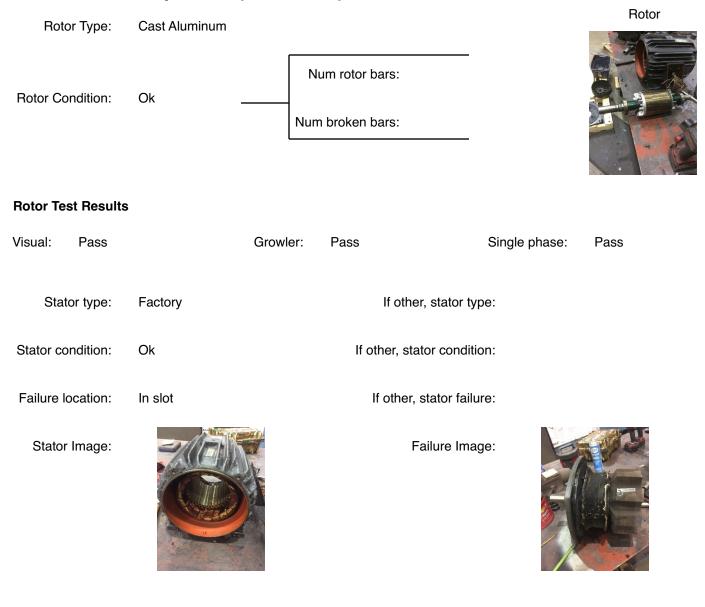

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



AC Electrical Inspection (Continued)

Winding color:	Like new	Winding	ı image	Winding Therma	Protection	Yes
Winding condition :	Solid					
Winding Thermal Protection DE:	_					
Winding Thermal Protection ODE:	_		5			
Stator test results:	Salvageable					
Megs incoming: Go	od	Surge incoming:	Good	Hi-pot in	coming:	Good
Winding Resistance Inc	coming					
Phase	es A to B	Phases B to C	Phase	es C to A	Resistive i	mbalance
Incoming						
Leads/jumpe	ers: Ok					
If other, leads/jumpe	ers:					

Mechanical Inspection

Inspect bolt holes and fasteners. Validate correct fasteners.

Shaft Condition:	Good	Bearings Retainer:	Yes
Type of grounding device:		Bearing DE Size:	6208
Shaft runout(TIR-Inbound):		Bearing ODE Size:	6207

Retainer condition:

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301 CENTRAL ARKANSAS 6812 Lindsey Rd. Little Rock, AR 72206 Phone 501-375-9178 Fax 501-375-4254



Mechanical Inspection (Continued)

Seals DE condition :	Worn	Brg. Seats DE:	Good
Seals DE type:	Slinger	If DE undersized, amt.:	
Seals DE size:		Brg. Seats ODE:	Good
Seals DE (inbound) condition :		If ODE undersized, amt.:	
Seals ODE condition :	Worn	Shaft damage:	ОК
Seals ODE type:	Slinger		
Seals ODE size:		Bushings/sleeves DE:	Ok
Seals ODE (inbound) condition :		Bushings/sleeves ODE:	Ok
Endbell fits/damage:	Good	Foot/Flange condition:	Ok
Endbell DE size:	3.1498	Foot flatness:	Pass
Endbell DE insulated?:	_		tomer or EASA spec(<10%
Endbell ODE size:	2.8347	variation)?	
Endbell ODE insulated?:	_		

VEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Conclusion

Component Failure

Clutch attachment windings

Cause of Failure

Clutch windings burned up.

Comments

Motor coils checked good. Motor machine fits check good. Replace bent and dented fan cover.

Service Tech name: Terrence Holland

Service Tech signature:

6

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301