



8/11/2021 7:39:08 AM

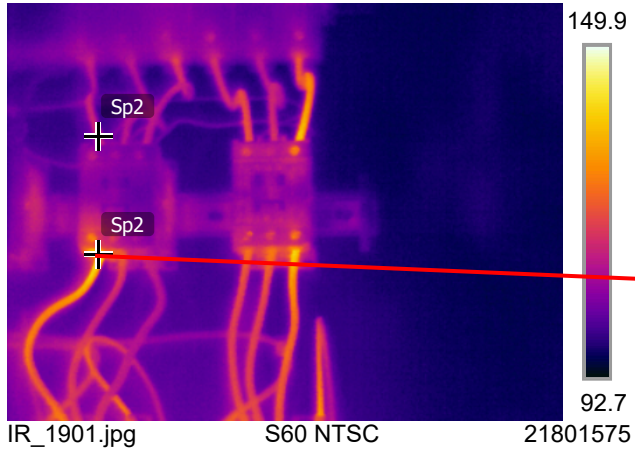

8/11/2021 7:39:18 AM

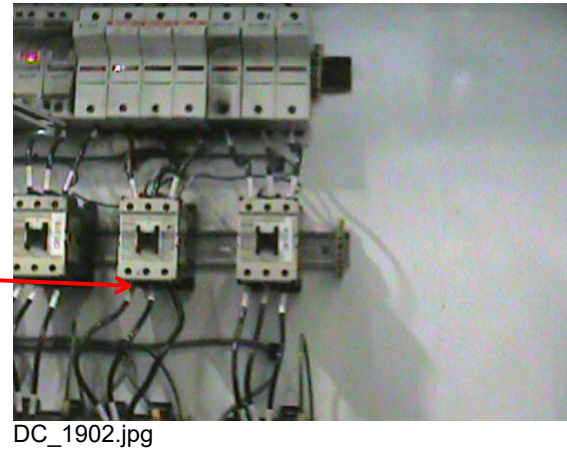

Measurements

Sp2	147.4 °F
Sp2	118.1 °F

Parameters

Emissivity	0.95
Refl. temp.	49 °F

Infrared data indicate a high resistance connection on the load side of phase A. Check the wire for damage. Replace if necessary, and repair as necessary tighten to proper torque.