


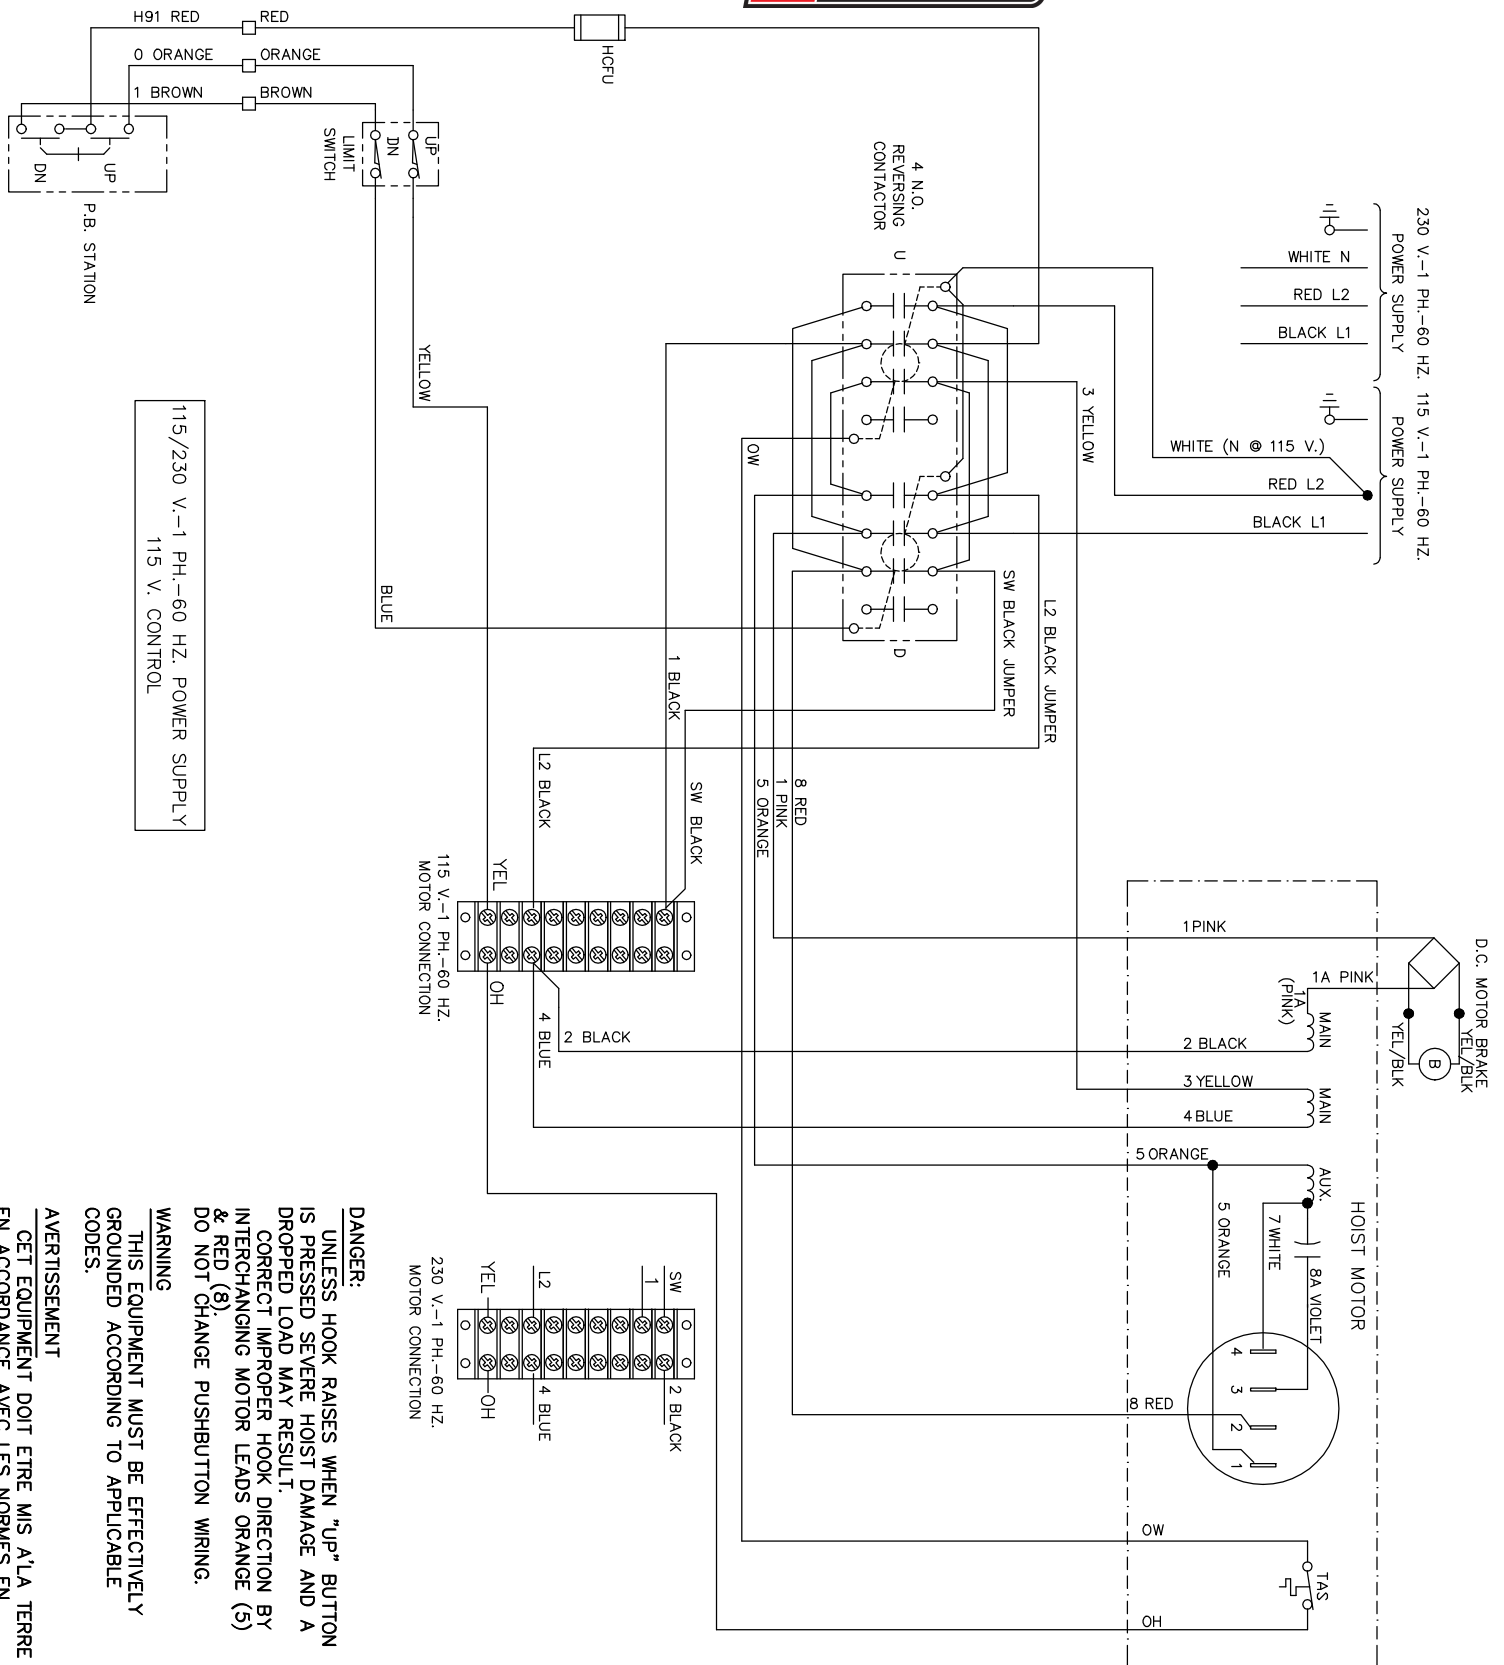

DANGER:

UNLESS HOOK RAISES WHEN "UP" BUTTON IS PRESSED SEVERE HOIST DAMAGE AND A DROPPED LOAD MAY RESULT.
CORRECT IMPROPER HOOK DIRECTION BY INTERCHANGING MOTOR LEADS ORANGE (5) & RED (8).
DO NOT CHANGE PUSHBUTTON WIRING.

WARNING

THIS EQUIPMENT MUST BE EFFECTIVELY
GROUNDED ACCORDING TO APPLICABLE
CODES.

AVERTISSEMENT

CET EQUIPEMENT DOIT ETRE MIS A LA TERRE EN ACCORDANCE AVEC LES NORMES EN VIGUEUR.

NO.	CHANGE	DATE	ITL.	WIRING DIAGRAM
1	YEL. & OH WERE ON U-AUX	2/90	BES	1 PHASE RECONNECTABLE, STEARNS REVERSING SWITCH
				D.C. SOLENOID BRAKE
				BUDGET ELECTRIC HOIST
				SC. -----
				DA. 6/28/89
				DR. VERBOS
				CK.
				 YALE • LIFT-TECH division of Columbus McKinnon Corporation Muskegon, Michigan 49443
				SHEET 1 OF MORE SHEETS
				330174