



WIRING DIAGRAMS FOR SHAW-BOX MOTOR DRIVEN TRAVERSE ARRANGEMENT (FOR 113533-76 AND 113533-77)

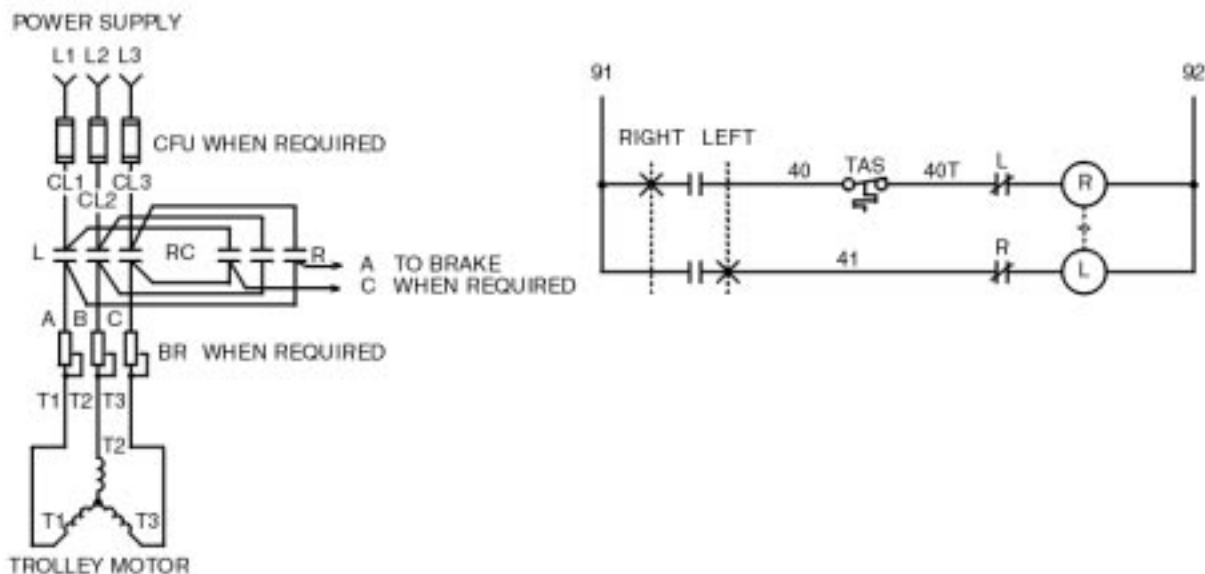

ELEMENTARY DIAGRAM

WIRE	DEVICE CONNECTED
L1	CFU
L2	CFU
L3	CFU
CL1	TB

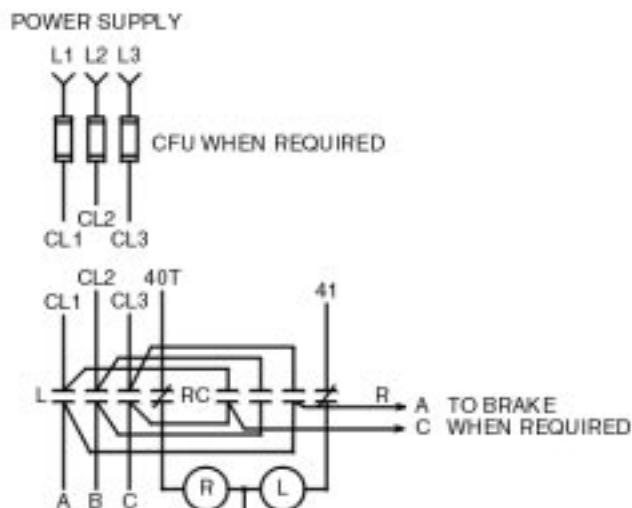

* WHEN BR REQUIRED
USE A,B,C
ELSE USE T1,T2,T3



CL2	TB	CFU, RC
CL3	TB	CFU, RC
A	TB	CFU, RC
B	TB	CFU, RC
C	TB	CFU, RC
40	TB	RC
40T	TB	RC
41	TB	RC

WARNING



THIS EQUIPMENT MUST BE EFFECTIVELY GROUNDING

CONNECTION DIAGRAM

329121

WIRING DIAGRAM FOR ONE SPEED TROLLEY CONTROL


POWER SUPPLY

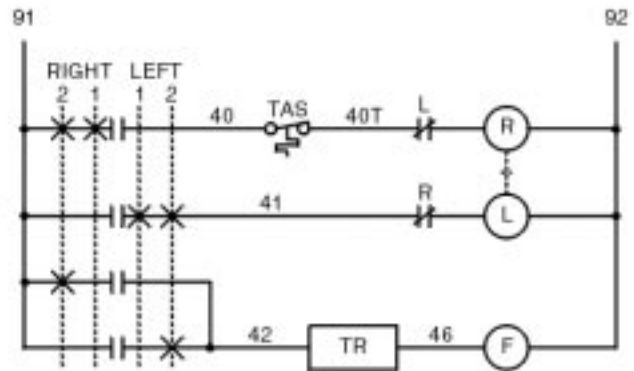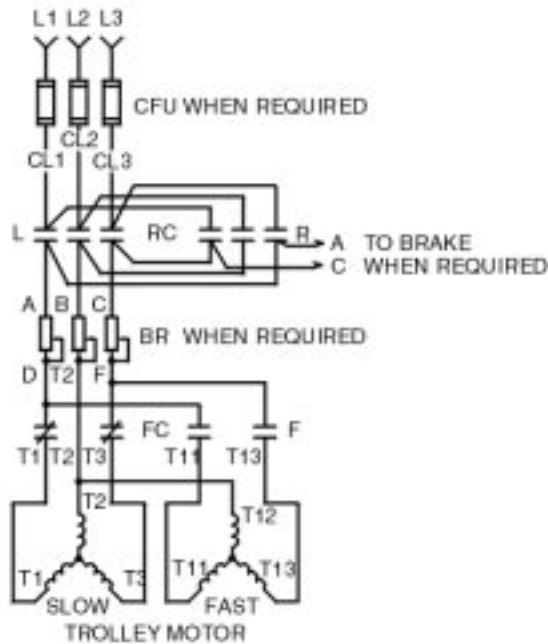


ELEMENTARY DIAGRAM

WIRE	DEVICE CONNECTED
L1	CFU
L2	CFU
L3	CFU
CL1	CFU, RC
CL2	CFU, RC
CL3	CFU, RC
A	RC, BR
B	RC, BR
C	RC, BR
D	BR, FC
F	BR, FC
T1	FC
T2	BR
T3	FC
T11	FC
T13	FC
40	FC
40T	FC
41	FC
42	TR
46	TR, FC
92	RC, FC


POWER SUPPLY

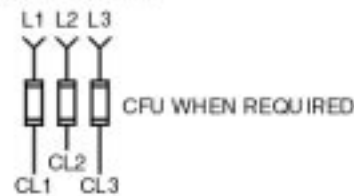

* WHEN BR REQUIRED
USE A,B,C
ELSE USE A,T2,C



* WHEN BR REQUIRED
USE D,T2,F
ELSE DO NOT USE D,F

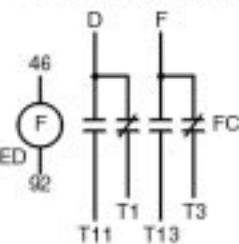

WARNING

THIS EQUIPMENT MUST BE EFFECTIVELY GROUNDED
ACCORDING TO APPLICABLE CODES

CONNECTION DIAGRAM

330770

WIRING DIAGRAM FOR TWO SPEED TROLLEY CONTROL