

# LR Field Services

Prepared for ARKANSAS INDUSTRIAL MACHINERY

3804 N. NONA ST  
NORTH LITTLE ROCK AR 72118

# Table of Contents



Hi-Speed Industrial Service  
7030 Ryburn Dr  
Millington, Tn 38053  
901-873-5300

## Field Service Ticket

FolderID: 102810  
FormID: 20130964

ARKANSAS INDUSTRIAL  
MACHINERY  
3804 N. NONA ST  
NORTH LITTLE ROCK, AR 72118

### Job Information

- |                        |                            |
|------------------------|----------------------------|
| 1. Hi-Speed Job Number | 102810                     |
| 2. Asset Type          | Atlas Copco air compressor |
| 3. Make                |                            |




- |                                 |  |
|---------------------------------|--|
| 4. Model                        |  |
| 5. Serial Number                |  |
| 6. Customer Asset ID/Asset Name |  |

### Service Call Details

- |                       |                                                                                                                                                                                                                                                                                                              |
|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 7. Service Objectives | Check fault on air compressor.                                                                                                                                                                                                                                                                               |
| 8. Services Performed | Motor had a U1 thermistor fault. Thermistor was reading open at the controls so I looked inside terminal box and found a broken wire. I fixed wire and got good readings at the terminal strip on the controller and unit is running now. Unit sounds very quiet. Unit is also running at around 37 percent. |

Hi-Speed Industrial Service disclaims all warranties, both express and implied, relating to the information, reports, opinions and analysis disclosed to the Customer by Hi-Speed. Hi-Speed shall not be liable for any errors or omissions, or any losses, injury or damages arising from the use of such information, reports, opinions and analysis by the Customer.

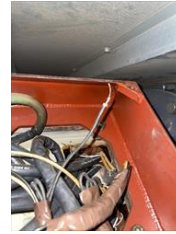

9. Service Technician Recommendations

**Approval Signatures**

10. Service Technician Signature

**Trevor Hall**

11. Customer Signature

**Justin Seigrist**