



## Field Service Ticket

FolderID: 103480  
FormID: 21618079

**Welspun Tubular (11685)**  
9301 Frazier Pike  
Little Rock, AR 72206

### Job Information

- |                                 |               |
|---------------------------------|---------------|
| 1. Hi-Speed Job Number          | 103480        |
| 2. Asset Type                   | Multiple fans |
| 3. Make                         |               |
| 4. Model                        |               |
| 5. Serial Number                |               |
| 6. Customer Asset ID/Asset Name | Multiple fans |

### Service Call Details



7. Service Objectives

*Balance fans.*

8. Services Performed

P8


*Tried to balance the ID fan but the bearings are bad on it and could not balance. I balanced the two blaster fans and the two dust collector fans need to be cleaned before balancing.*



*Tried to balance ID fan but the bearings are bad so I could not balance. Fan is bouncing around inside the housing.*



*Blaster 2 fan started at 2.8 mils and ended at 0.2 and 0.9 mils. Good.*

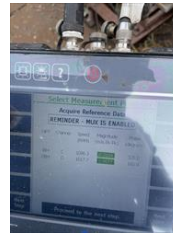

*Blaster 2*



*Blaster fan 1. Started at 3 mils and ended at 0.6 and 1.6. Fan is bent and wobbling inside housing but balance is good.*



*Blaster 1*

9. Service Technician Recommendations

*Bearings need changed on the small fan inside the building. The two dust collector fans need to be cleaned before balancing. Ravi is going to schedule a time with Daniel for me to come back and balance the other fans if new bearings and cleaning didn't solve the issue.*

### Approval Signatures

10. Service Technician Signature

**Trevor Hall**

A handwritten signature in black ink, appearing to be 'Trevor Hall', written in a cursive style.

11. Customer Signature

**Ravi Jain**

A handwritten signature in black ink, appearing to be 'Ravi Jain', written in a cursive style.