



## Field Service Ticket

FolderID: 103819  
FormID: 22552322

Evergreen Packaging (10150)  
Paper Mill  
Pine Bluff, AR 71601

### Job Information

- |                                 |               |
|---------------------------------|---------------|
| 1. Hi-Speed Job Number          | 103819        |
| 2. Asset Type                   | Multiple fans |
| 3. Make                         |               |
| 4. Model                        |               |
| 5. Serial Number                |               |
| 6. Customer Asset ID/Asset Name |               |

### Service Call Details




7. Service Objectives  
*To change out bearings on one fan and balance three fans total.*

8. Services Performed

P8

*#2 Mach-fan pump mtr cooling fan 92a01 has a bad front bearing and is not able to be balanced. It has .050 of play in the bearing and spins 2400 rpm. MB Former was at 0.6 mils-good. Changed out bearings on #2 Mach wet end drive mtr cooling fan and checked balance. Balance after new bearings was 0.8 mils-good at 2073 rpm. Customer supplied new bearings for #2 Mach fan so we cut off old bearings and replaced with new bearings. Checked balance and fan was at 0.2 mils.*

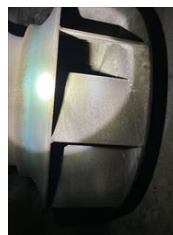



#2 Mach wet fan

MB Former motor



#2 Mach fan

## 9. Service Technician Recommendations

### Approval Signatures

10. Service Technician Signature

Trevor Hall



11. Customer Signature

**Jeremy Smith**

A handwritten signature in black ink, appearing to read 'J. Smith', is written over a horizontal line.