



Hi-Speed Industrial Service  
7030 Ryburn Dr  
Millington, Tn 38053  
901-873-5300

## Field Service Ticket

FolderID: 103933  
FormID: 22752785

**Bryce Corporation (10053-BRC)**

450 S. Benton  
Searcy, AR 72143

Die Shop

### Job Information



1. Hi-Speed Job Number **103933**
2. Asset Type **blower fan**
3. Make **P3**




4. Model
5. Serial Number
6. Customer Asset ID/Asset Name

### Service Call Details



7. Service Objectives **P7**  
*Initial unbalance 11.9 mils inboard and 5.5 mils outboard. Final 0.1 inboard and 1.0 outboard*

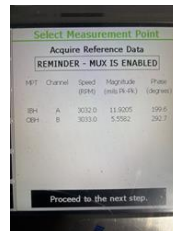

8. Services Performed  
*Balanced fan. Customer had buildup on initial balance weights when I showed up for the rebalance. Drilled holes and installed bolts. Shaft is bent .020" on pulley end and .010 on fan end. Balanced to 1.1 and 1.1 mils on each end. Fan needs pulled and have a new shaft made. Customer also let me bring in the old fan for repair and new shaft. Trevor*
9. Service Technician Recommendations

### Approval Signatures

10. Service Technician Signature **Shon Jones**

Hi-Speed Industrial Service disclaims all warranties, both express and implied, relating to the information, reports, opinions and analysis disclosed to the Customer by Hi-Speed. Hi-Speed shall not be liable for any errors or omissions, or any losses, injury or damages arising from the use of such information, reports, opinions and analysis by the Customer.

11. Customer Signature

Shane Bitner

A handwritten signature in black ink, appearing to read "Shane Bitner", with a stylized, overlapping flourish at the end.