

LR Field Services

Prepared for Sage V Foods

5901 SLOAN DRIVE
LITTLE ROCK AR 72206

Table of Contents

Field Service Ticket

1.0

Hi-Speed Industrial Service disclaims all warranties, both express and implied, relating to the information, reports, opinions and analysis disclosed to the Customer by Hi-Speed. Hi-Speed shall not be liable for any errors or omissions, or any losses, injury or damages arising from the use of such information, reports, opinions and analysis by the Customer.

Printed on 07/14/2025

Powered by [INSPECTALL](#)

Table of Contents



Hi-Speed Industrial Service
7030 Ryburn Dr
Millington, Tn 38053
901-873-5300

Field Service Ticket

FolderID: 104888
FormID: 25126273

Sage V Foods

5901 SLOAN DRIVE
LITTLE ROCK, AR 72206

Job Information

1. Hi-Speed Job Number	104888
2. Asset Type	10 fans
3. Make	
4. Model	
5. Serial Number	
6. Customer Asset ID/Asset Name	


Service Call Details

7. Service Objectives

Check vibration on a fan

8. Services Performed

*Ended up checking and balancing 10 fans.
Fan 1 started at 2.5 and 2.5. Ended at 1.2 and 1.2
Fan 2 was good at 0.9 and 0.8
Fan 3 started at 1.4 and 0.25. Ended at 0.26 and 0.25
Fan 4 was good at 0.2 and 0.6
Fan 5 motor needs replaced. You can lift up the shaft
Fan 6 started at 3.9 and 2.5. Ended at 0.7 and 0.7
Fan 7 started at 0.3 and 1.8. Ended at 0.4 and 0.5
Fan 8 is good at 0.5 and 0.1
Fan 9 started at 4.9 and 2.3. Ended at 0.9 and 0.4
Fan 10 started at 1.9 and 1.1. Ended at 0.6 and 0.4*

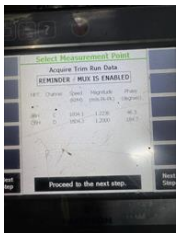


Fan 1



Fan 2



Fan 6

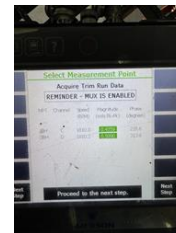

Fan 7



Fan 8



Fan 9



Fan 4




Fan 3

Hi-Speed Industrial Service disclaims all warranties, both express and implied, relating to the information, reports, opinions and analysis disclosed to the Customer by Hi-Speed. Hi-Speed shall not be liable for any errors or omissions, or any losses, injury or damages arising from the use of such information, reports, opinions and analysis by the Customer.

Printed on 07/14/2025

Powered by [INSPECTALL](#)

1.0

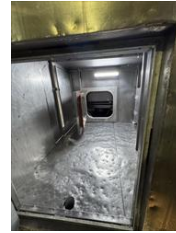

9. Service Technician Recommendations
Replace fan 5 motor

Approval Signatures

10. Service Technician Signature

Trevor Hall

11. Customer Signature

Bobby Euton