

Job Information

| Job #: | 94158 | | | | Date: | May 15, 2018 |
|-----------|-------|----------------|----|----------------|-------|--------------|
| Priority: | _ | Authorized OT: | No | Authorized by: | | |

Customer Information

Name:Entergy White BluffMotor#:

Name Plate Information

| Westinghouse | Enclosure : | Open Drop Proof (ODP) | Horsepower/kW: | 1.1 |
|--------------|----------------|-----------------------------------|---|---|
| 7905N | Model#: | ТВАН | Service Factor: | 1.0 |
| 213TZ | Rated RPM: | 900 | Rated Voltage: | 460 |
| 3 | Rated Amps: | 2.3 | Cycles: | 60 |
| | 7905N 213TZ | 7905N Model#: 213TZ Rated RPM: | YesYesYes7905NModel#:TBAH213TZRated RPM:900 | YesYesYesYes7905NModel#:TBAHService Factor:213TZRated RPM:900Rated Voltage: |

Special design: No

VUEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



AC Electrical Inspection

| Megs at reassemb | oly: Good | Surge at reassem | bly: Good | Hi-pot reassembly: Good | | | |
|---|---------------|------------------|-------------|-------------------------|--|--|--|
| Winding Resistance Incoming | | | | | | | |
| | Phases A to B | Phases B to C | Phases C to | A Resistive imbalance | | | |
| Outgoing | 20.702 | 20.638 | 20.665 | 0.2 | | | |
| Test Run Inspection Date May 15, 2018 | | | | | | | |
| — I have merged this motor and verified that all electrical tests are complete! | | | | | | | |
| Power Supply | | | | | | | |
| | | Phase A | Phase B | Phase C | | | |
| No Load Volta | ge | 460 | 459 | 460 | | | |
| No Load Curre | ent | 1.4 | 1.4 | 1.5 | | | |

Temperatures: (Degrees Fahrenheit)

Test run ball-bearing motors for 15 minutes.

Test run sleeve bearing motors for 60 minutes.

Temperature rise at the end of test run should be less than 2° every five minutes.

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



MILLINGTON, TN LITTLE ROCK, AR


Test Run Inspection (Continued)

Ambient Temp:

| TIME | DE | Degree Change | ODE | Degree Change |
|---------|----|---------------|-----|---------------|
| START: | | | | |
| 5 MIN: | | | | |
| 10 MIN: | | | | |
| 15 MIN: | | | | |
| 20 MIN: | | | | |
| 25 MIN: | | | | |
| 30 MIN: | | | | |
| 35 MIN: | | | | |
| 40 MIN: | | | | |
| 45 MIN: | | | | |
| 50 MIN: | | | | |
| 55 MIN: | | | | |
| 60 MIN: | | | | |



Test Run Inspection (Continued)

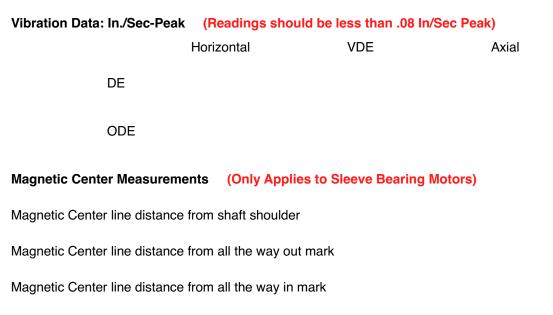

Total Motor End Float

Additional photos









Yes, the shaft has been isolated for delivery.

Service Tech name:

RHR

Service Tech signature:

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301