



MILLINGTON, TN

LITTLE ROCK, AR

Job Information

Job #: 95107

Date: January 28, 2019

Priority: —

Authorized OT: No

Authorized by:

Customer Information

Name: Highland Dairy

Motor#:

Name Plate Information

Manufacturer: Thermo King

Enclosure : Totally Enclosed
Fan Cooled

Horsepower/kW: 7.2

Serial#: 1e46990g01

Model#: 182778wj005

Service Factor:

Frame: 184tt

Rated RPM: 1765

Rated Voltage: 230/460

Phase: 3

Rated Amps: 19.4/9.7

Cycles: 60

Special design: No

WEST TENNESSEE

7030 Ryburn Drive
Millington, TN 38053
Phone 901-873-5300
Fax 901-873-5301

CENTRAL ARKANSAS

6812 Lindsey Rd.
Little Rock, AR 72206
Phone 501-375-9178
Fax 501-375-4254



MILLINGTON, TN

LITTLE ROCK, AR

AC Electrical Inspection

Megs at reassembly: Good Surge at reassembly: Good Hi-pot reassembly: Good

Winding Resistance Incoming

	Phases A to B	Phases B to C	Phases C to A	Resistive imbalance
Outgoing	0.62	0.62	0.62	0.3

Test Run Inspection

Date January 28, 2019

Yes I have merged this motor and verified that all electrical tests are complete!

Power Supply

	Phase A	Phase B	Phase C
No Load Voltage	459	456	457
No Load Current	4.7	5.1	4.8

Temperatures: (Degrees Fahrenheit)

Test run ball-bearing motors for 15 minutes.

Test run sleeve bearing motors for 60 minutes.

Temperature rise at the end of test run should be less than 2° every five minutes.

WEST TENNESSEE
7030 Ryburn Drive
Millington, TN 38053
Phone 901-873-5300
Fax 901-873-5301

CENTRAL ARKANSAS
6812 Lindsey Rd.
Little Rock, AR 72206
Phone 501-375-9178
Fax 501-375-4254



MILLINGTON, TN

LITTLE ROCK, AR

Test Run Inspection (Continued)

Ambient Temp: 73

TIME	DE	Degree Change	ODE	Degree Change
------	----	---------------	-----	---------------

START:

5 MIN:

10 MIN:

15 MIN:	75		75	
---------	----	--	----	--

20 MIN:

25 MIN:

30 MIN:

35 MIN:

40 MIN:

45 MIN:

50 MIN:

55 MIN:

60 MIN:

WEST TENNESSEE

7030 Ryburn Drive
Millington, TN 38053
Phone 901-873-5300
Fax 901-873-5301

CENTRAL ARKANSAS

6812 Lindsey Rd.
Little Rock, AR 72206
Phone 501-375-9178
Fax 501-375-4254

Test Run Inspection (Continued)

Vibration Data: In./Sec-Peak (Readings should be less than .08 In/Sec Peak)

	Horizontal	VDE	Axial
DE	0.1	0.1	0.1
ODE	0.1	0.1	0.1

Magnetic Center Measurements (Only Applies to Sleeve Bearing Motors)


Magnetic Center line distance from shaft shoulder

Magnetic Center line distance from all the way out mark

Magnetic Center line distance from all the way in mark

Total Motor End Float

Additional photos

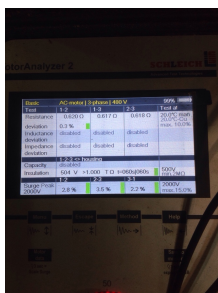

☐ Yes, the shaft has been isolated for delivery.

Service Tech name: Trevor Hall

Service Tech signature:

