



4/12/2021 7:04:28 AM

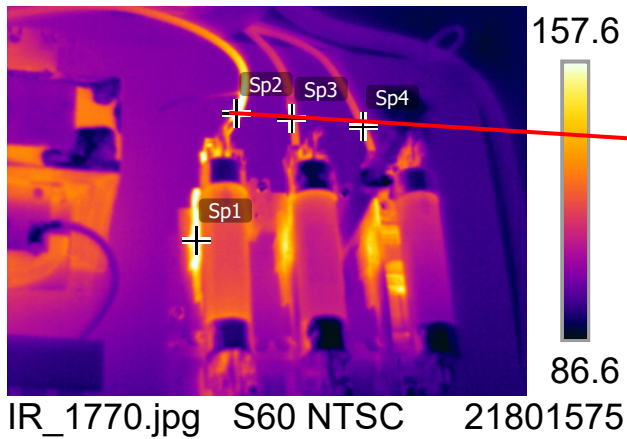

4/12/2021 7:04:41 AM

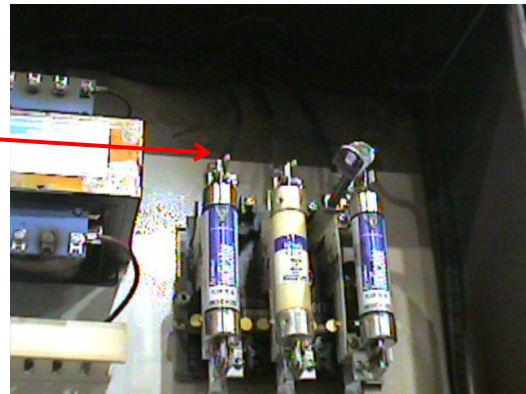

Measurements

Sp1	170.5 °F
Sp2	167.7 °F
Sp3	125.9 °F
Sp4	125.8 °F

Parameters

Emissivity	0.95
Refl. temp.	49 °F

Asset #2611.

Infrared indicates a high resistance connection on the line side of phase A fuse. The fuse holder is also overheating. Clean wire and terminal. Inspect for heat damage on fuse holder replace if needed. Torque wire to manufacturer recommended torque spec.