

# LR Field Services

Prepared for Comfort Systems

9924 Landers Rd  
NORTH LITTLE ROCK Arkansas 72117

# Table of Contents




Hi-Speed Industrial Service  
7030 Ryburn Dr  
Millington, Tn 38053  
901-873-5300

## Field Service Ticket

FolderID: 102299  
FormID: 18952194


**Comfort Systems**  
9924 Landers Rd  
NORTH LITTLE ROCK, Arkansas  
72117

### Job Information

1. Hi-Speed Job Number	102299
2. Asset Type	hot water pump
	
3. Make	ingersol rand
4. Model	unknown
5. Serial Number	unknown
6. Customer Asset ID/Asset Name	Boiler pump main motor
<b>Service Call Details</b>	
7. Service Objectives	<i>Diagnose and assist with reassembly of pump</i>
8. Services Performed	

Hi-Speed Industrial Service disclaims all warranties, both express and implied, relating to the information, reports, opinions and analysis disclosed to the Customer by Hi-Speed. Hi-Speed shall not be liable for any errors or omissions, or any losses, injury or damages arising from the use of such information, reports, opinions and analysis by the Customer.

We tried to do what we could to get the pump up and going quickly but found out that the seals will not seat in the housings without machine work. We removed pump from the skid and brought back to the shop for further evaluation. UPDATE. I was able to rebuild pump in place with new seals. Pump seal part number HD-8168M. US seal. Pressurized pump to capacity and it held pressure. I laser aligned the motor to the pump. We tested ran it and had no leaks. Unit ran good. Comfort systems is supposed to come back over to solder on the drain lines that they removed.

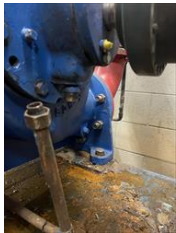

9. Service Technician Recommendations
- Let us further evaluate the condition of the unit.

Approval Signatures

10. Service Technician Signature
- Trevor Hall

11. Customer Signature
- Al Thomas