

MILLINGTON, TN LITTLE ROCK, AR

Job Information

Job #:	94509				Date:	August 7, 2018
Priority:	_	Authorized OT:	No	Authorized by:		

Customer Information

Name:	Delta Plastics		Reason:	
Contact:		Motor#:		PO#:
Application:	_	Special notes:		

Name Plate Information

Manufacturer:	Lesson	Enclosure :	Totally Enclosed Fan Cooled	Enclosure Type image
Serial#:	193319.60/ RMFT75/500	Model#:	C160T1FZ44A/ KAD28240	
Service Factor:		Frame:	160L	
Horsepower/kW:	15KW	Rated RPM:	1775	121-124
Rated Amps:	49/24.5	Rated Voltage:	230/460	- 107
Phase:	3	Cycles:	60	
Special design:	No			

Nameplate

DE

ODE



F2



Тор



WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301











MILLINGTON, TN LITTLE ROCK, AR

Mechanical Inspection

Inspect bolt holes and fasteners. Validate correct fasteners.

Does the shaft turn freely?:	Yes	Contaminant(s):	None
Shaft rotation:	Bi-directional	Contaminant(s) Amt:	None
Shaft grounding device present?:	No		
Type of grounding device:			

Shaft runout(TIR-Inbound):

Bearings DE:	Other	Bearings DE make:	NSK
Insulated:	No	Bearing DE Size:	6309Z
Bearings ODE:	Other	Bearings ODE make:	NSK
Bearing Type:	Ball	Bearing ODE Size:	6209Z
Bearings Retainer:	Yes	Thermal Protection:	No
Retainer condition:	_	Thermal Protection Type:	_

Bearing Type Image



Bearing Make Image



WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301 CENTRAL ARKANSAS 6812 Lindsey Rd. Little Rock, AR 72206 Phone 501-375-9178 Fax 501-375-4254 Bearing Retainer Image



Thermal Protection



Mechanical Inspection (Continued)

Lubrication Type:	Grease	Thermal Protection device DE:	_
Lubrication brand inbound:	Mobile Polyrex EM	Thermal Protection device ODE:	_
Lubrication brand outbound:	Mobile Polyrex EM		
Grease Amt DE:	Full	Grease Cond. DE:	New
Grease Amt ODE:	Full	Grease Cond. ODE:	New
Seals DE type:	N/A		
Seals DE size:			
Seals DE (inbound) condition :			
Seals ODE type:	N/A		
Seals ODE size:			
Seals ODE (inbound) condition :			
Shaft damage cause:	None	Shaft Image:	



VEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



MILLINGTON, TN LITTLE ROCK, AR

Mechanical Inspection (Continued)

Brg. Image:



Water jacket:	N/A		Fan:	Ok	Frame co	ond.:	Good
Motor Mount Posit	ion: Horizontal/Fo	oot mount			Endbell type:	Sing	le piece
Missing parts?	,				Endbell Image:	1	
J-Box cover	O-rings	J-Box					
HH cover	Glands	Vone					
Other missing pa	rts						

VEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Mechanical Inspection (Continued)

Air Gap Meaurements (N/A on S	Does Air Gap Meet Customer or EASA spec(<10% variation)?	
DE @ 0	ODE @ 0	_
DE @ 90	ODE @ 90	
DE @ 180	ODE @ 180	
DE @ 270	ODE @ 270	

AC Electrical Inspection

Number of leads:	9	Terminal Markings:	1-9	
Length of leads:		REF: NEMA Stds Markings Identifie	s. MG 1-2009, Rev. 1- ed By Color:	-2010, 2.41-Terminal
Size of leads:		1-Blue 2-White 3-Orange	5-Black 6-No color assigned 7-No color assigned	P1-No color assigned P2-Brown
Lead condition:	Good	4-Yellow	8-Red	
Lug type:		Connections As Red	ceived:	
Lug Condition:	Good	Т	Ferminal	Lugs
Lug size: Lug Attachment:	_			

AUE


Alle

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



MILLINGTON, TN LITTLE ROCK, AR

AC Electrical Inspection (Continued)

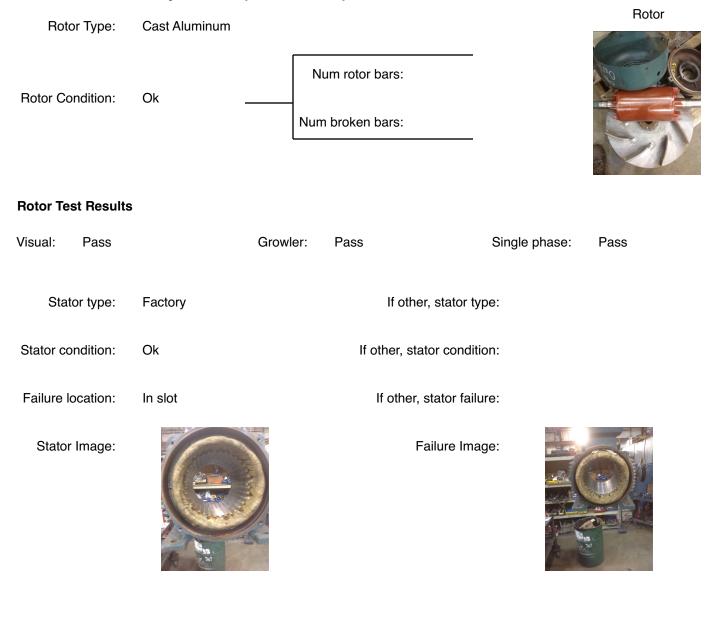

WEST TENNESSEE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



AC Electrical Inspection (Continued)

Winding color: Like new		Winding	Winding The	ermal Protection	n: Yes	
Winding condition :	Solid					
Winding Thermal Protection DE:	_					
Winding Thermal Protection ODE:	_					
Stator test results:	Rewind					
Megs incoming: Goo	d	Surge incoming:	Good	Hi-p	ot incoming:	Good
Winding Resistance Ir	coming					
Phas	es A to B	Phases B to C		Phases C to A	Resistive	imbalance
Incoming						
Leads/jump	ers: Ok					

If other, leads/jumpers:

VEST TENNESSE 7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301



Conclusion

Component Failure

Cause of Failure

Comments

Bearings Sheeves Belts

Service Tech name: F

Robert Wiley

Service Tech signature:

Solf Willen

WEST TENNESSEE

7030 Ryburn Drive Millington, TN 38053 Phone 901-873-5300 Fax 901-873-5301