



MILLINGTON, TN

LITTLE ROCK, AR

MECHANICAL EVALUATION

Job Information

Job #: 140206

Date: July 18, 2019

Priority: —

Authorized OT: No

Authorized by:

Customer Information

Name: USG

Reason:

Contact:

Motor#:

PO#:

Application: —

Special notes:

Name Plate Information

Manufacturer:

Enclosure : Open Drop Proof (ODP)

Horsepower/kW:

Serial#:

Rated Voltage:

Phase:

Rated RPM:

Service Factor:

Special design: No

Cycles:

Rated Amps:

Model#:

Frame:

WEST TENNESSEE
7030 Ryburn Drive
Millington, TN 38053
Phone 901-873-5300
Fax 901-873-5301

CENTRAL ARKANSAS
6812 Lindsey Rd.
Little Rock, AR 72206
Phone 501-375-9178
Fax 501-375-4254



MILLINGTON, TN

LITTLE ROCK, AR

MECHANICAL EVALUATION

Mechanical Inspection

Shaft grounding device present?:	No	Shaft runout(TIR-Inbound):	.0000
Bearings Retainer:	Yes	Retainer condition:	Good
Bearing Type:	Ball	IS BEARING A THRUST BRG:	NO
DE BEARING NAME AND NUMBER:	SKF-6316	ODE BEARING NAME AND #:	SKF6316
DE BEARING SIZE I.D.:	3.1496	ODE BEARING SIZE I.D.:	3.1496
DE BEARING SIZE O.D.:	6.6929	ODE BEARING SIZE O.D.:	6.6929
Is bearing Insulated:	No	Is bearing Insulated:	No
Thermal Protection:	No	Thermal Protection Type:	—

Bearing Type Image

Bearing Make Image

Bearing Retainer Image

Thermal Protection

WEST TENNESSEE

7030 Ryburn Drive
Millington, TN 38053
Phone 901-873-5300
Fax 901-873-5301

CENTRAL ARKANSAS

6812 Lindsey Rd.
Little Rock, AR 72206
Phone 501-375-9178
Fax 501-375-4254

Mechanical Inspection (Continued)

DE SHAFT
IMAGE:



ODE SHAFT IMAGE:



Water jacket: N/A

Fan: Ok

Frame cond.: Good




Motor Mount
Position: Horizontal/Foot mount

Endbell type: Single piece

DE Endbell Image:



ODE Endbell Image:

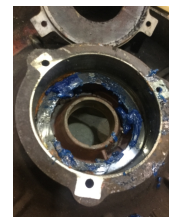

WEST TENNESSEE

7030 Ryburn Drive
Millington, TN 38053
Phone 901-873-5300
Fax 901-873-5301

CENTRAL ARKANSAS

6812 Lindsey Rd.
Little Rock, AR 72206
Phone 501-375-9178
Fax 501-375-4254



MILLINGTON, TN

LITTLE ROCK, AR

MECHANICAL EVALUATION

Mechanical Inspection (cont)

Inspect bolt holes and fasteners. Validate correct fasteners.

Shaft Condition: Good

DE AND ODE SEAL TYPE: Slinger

DE SHAFT EXT.: 2.874

ODE SHAFT EXT.: 2.517

DE SHAFT EXT. KEYWAY: .750

ODE SHAFT EXT. KEYWAY: .500

DE SHAFT AIR SEAL (inner): 3.626

ODE SHAFT AIR SEAL (inner): 3.541

(Outer): 2.998

(Outer): 2.999

DE SHAFT BRG JOURNAL : 3.150

ODE SHAFT BRG JOURNAL : 3.150

If journal is undersize,amount:

If journal is undersize,amount:

DE BEARING SEAT: Good

ODE BEARING SEAT: Good

Shaft damage cause: None

REPAIR OR REPLACE SHAFT:

ANY OTHER SHAFT DAMAGE NOT
PREVIOUSLY MENTIONED:

WEST TENNESSEE

7030 Ryburn Drive
Millington, TN 38053
Phone 901-873-5300
Fax 901-873-5301

CENTRAL ARKANSAS

6812 Lindsey Rd.
Little Rock, AR 72206
Phone 501-375-9178
Fax 501-375-4254



MILLINGTON, TN

LITTLE ROCK, AR

MECHANICAL EVALUATION

Mechanical Inspection (Continued)

DE Endbell fits/damage: Good

ODE Endbell fits/damage: Good

DE END BELL BRG FIT: 6.693

ODE END BELL BRG FIT: 6.693

DE END BELL AIR SEAL: 3.650(inner)3.016(outer)

ODE END BELL AIR SEAL: 3.551(inner)3.016(outer)

Endbell DE insulated?: No

Endbell ODE insulated?: No

Bushings/sleeves DE: Ok

Bushings/sleeves ODE: Ok

Does Air Gap Meet Customer or EASA spec(<10% variation)?

Yes

WEST TENNESSEE

7030 Ryburn Drive
Millington, TN 38053
Phone 901-873-5300
Fax 901-873-5301

CENTRAL ARKANSAS

6812 Lindsey Rd.
Little Rock, AR 72206
Phone 501-375-9178
Fax 501-375-4254



MILLINGTON, TN

LITTLE ROCK, AR

MECHANICAL EVALUATION

Conclusion

LIST MACHINE WORK
REQUIRED : ^^^^no machine req'd^^^^

Service Tech name: Billy mays

WEST TENNESSEE
7030 Ryburn Drive
Millington, TN 38053
Phone 901-873-5300
Fax 901-873-5301

CENTRAL ARKANSAS
6812 Lindsey Rd.
Little Rock, AR 72206
Phone 501-375-9178
Fax 501-375-4254