



MILLINGTON, TN

LITTLE ROCK, AR

MECHANICAL EVALUATION

Job Information

Job #: 140417

Date: August 19, 2019

Priority: —

Authorized OT: No

Authorized by:

Customer Information

Name: Ktg

Reason:

Contact:

Motor#:

PO#:

Application: —

Special notes:

Name Plate Information

Manufacturer:

Enclosure : Open Drop Proof
(ODP)

Horsepower/kW:

Serial#:

Rated Voltage:

Phase:

Rated RPM:

Service Factor:

Special design: Yes

Cycles:

Rated Amps:

Model#:

Frame:

WEST TENNESSEE
7030 Ryburn Drive
Millington, TN 38053
Phone 901-873-5300
Fax 901-873-5301

CENTRAL ARKANSAS
6812 Lindsey Rd.
Little Rock, AR 72206
Phone 501-375-9178
Fax 501-375-4254

Mechanical Inspection

Shaft grounding device present?:	No	Shaft runout(TIR-Inbound):	.0000
Bearings Retainer:	Yes	Retainer condition:	Good
Bearing Type:	Ball	IS BEARING A THRUST BRG:	No
DE BEARING NAME AND NUMBER:	NSK 6007	ODE BEARING NAME AND #:	NSK 6002
DE BEARING SIZE I.D.:	1.378	ODE BEARING SIZE I.D.:	.5906
DE BEARING SIZE O.D.:	2.4409	ODE BEARING SIZE O.D.:	1.2598
Is bearing Insulated:	No	Is bearing Insulated:	No
Thermal Protection:	Yes	Thermal Protection Type:	RTD



Mechanical Inspection (Continued)

DE SHAFT
IMAGE:




ODE SHAFT IMAGE:



Water jacket: N/A

Fan: N/A

Frame cond.: Good

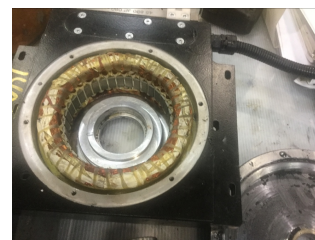


Motor Mount
Position: Other

Endbell type: Single piece

DE Endbell Image:



ODE Endbell Image:

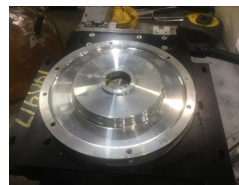



MILLINGTON, TN

LITTLE ROCK, AR

MECHANICAL EVALUATION

Mechanical Inspection (cont)

Inspect bolt holes and fasteners. Validate correct fasteners.

Shaft Condition: Good

DE AND ODE SEAL TYPE: —

DE SHAFT EXT.: 1.378

ODE SHAFT EXT.: XXXXXXX

DE SHAFT EXT. KEYWAY: XXXXXXX

ODE SHAFT EXT. KEYWAY: XXXXXXX

DE SHAFT AIR SEAL (inner): XXXXXX

ODE SHAFT AIR SEAL (inner): XXXXXXX

(Outer): XXXXXX

(Outer): XXXXXXX

DE SHAFT BRG JOURNAL : 1.378

ODE SHAFT BRG JOURNAL : .5906

If journal is undersize,amount: NONE

If journal is undersize,amount: .000000

DE BEARING SEAT: Good

ODE BEARING SEAT: Good

Shaft damage cause: None

REPAIR OR REPLACE SHAFT:

ANY OTHER SHAFT DAMAGE NOT
PREVIOUSLY MENTIONED:

WEST TENNESSEE

7030 Ryburn Drive
Millington, TN 38053
Phone 901-873-5300
Fax 901-873-5301

CENTRAL ARKANSAS

6812 Lindsey Rd.
Little Rock, AR 72206
Phone 501-375-9178
Fax 501-375-4254



MILLINGTON, TN

LITTLE ROCK, AR

MECHANICAL EVALUATION

Mechanical Inspection (Continued)

DE Endbell fits/damage: Good

ODE Endbell fits/damage: Good

DE END BELL BRG FIT: 2.4409

ODE END BELL BRG FIT: 1.261

DE END BELL AIR SEAL:

ODE END BELL AIR SEAL:

Endbell DE insulated?: No

Endbell ODE insulated?: No

Bushings/sleeves DE: Ok

Bushings/sleeves ODE: Ok

Does Air Gap Meet Customer or EASA spec(<10% variation)?

Yes

WEST TENNESSEE

7030 Ryburn Drive
Millington, TN 38053
Phone 901-873-5300
Fax 901-873-5301

CENTRAL ARKANSAS

6812 Lindsey Rd.
Little Rock, AR 72206
Phone 501-375-9178
Fax 501-375-4254



MILLINGTON, TN

LITTLE ROCK, AR

MECHANICAL EVALUATION

Conclusion

LIST MACHINE WORK
REQUIRED :

*****BORE AND SLEEVE O.D.E. BRG FIT*****

Service Tech name: BILLY MAYS

WEST TENNESSEE
7030 Ryburn Drive
Millington, TN 38053
Phone 901-873-5300
Fax 901-873-5301

CENTRAL ARKANSAS
6812 Lindsey Rd.
Little Rock, AR 72206
Phone 501-375-9178
Fax 501-375-4254