



MILLINGTON, TN

LITTLE ROCK, AR

MECHANICAL EVALUATION

Job Information

Job #: 140498

Date: August 30, 2019

Priority: —

Authorized OT: No

Authorized by:

Customer Information

Name: On site environmental

Reason:

Contact:

Motor#:

PO#:

Application: —

Special notes:

Name Plate Information

Manufacturer:

Enclosure : Open Drop Proof
(ODP)

Horsepower/kW:

Serial#:

Rated Voltage:

Phase:

Rated RPM:

Service Factor:

Special design: No

Cycles:

Rated Amps:

Model#:

Frame:

WEST TENNESSEE
7030 Ryburn Drive
Millington, TN 38053
Phone 901-873-5300
Fax 901-873-5301

CENTRAL ARKANSAS
6812 Lindsey Rd.
Little Rock, AR 72206
Phone 501-375-9178
Fax 501-375-4254

Mechanical Inspection

Shaft grounding device present?:	No	Shaft runout(TIR-Inbound):	.000
Bearings Retainer:	Yes	Retainer condition:	—
Bearing Type:	Ball	IS BEARING A THRUST BRG:	No
DE BEARING NAME AND NUMBER:	FAG 6311-2Z-C3	ODE BEARING NAME AND #:	Fag 6310 -2z-c3
DE BEARING SIZE I.D.:	55mm	ODE BEARING SIZE I.D.:	50mm
DE BEARING SIZE O.D.:	120mm	ODE BEARING SIZE O.D.:	110mm
Is bearing Insulated:	No	Is bearing Insulated:	No
Thermal Protection:	Yes	Thermal Protection Type:	—

**WEST TENNESSEE**

7030 Ryburn Drive
Millington, TN 38053
Phone 901-873-5300
Fax 901-873-5301

CENTRAL ARKANSAS

6812 Lindsey Rd.
Little Rock, AR 72206
Phone 501-375-9178
Fax 501-375-4254



MILLINGTON, TN

LITTLE ROCK, AR


MECHANICAL EVALUATION

Mechanical Inspection (Continued)

DE SHAFT
IMAGE:



ODE SHAFT IMAGE:

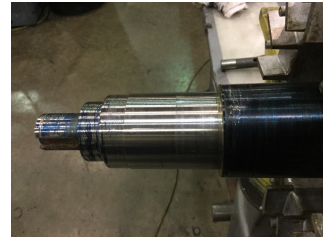

Water jacket: Ok

Fan: Ok

Frame cond.: Good

Motor Mount
Position: Horizontal/Foot mount

Endbell type: Single piece

DE Endbell Image:



ODE Endbell Image:



WEST TENNESSEE
7030 Ryburn Drive
Millington, TN 38053
Phone 901-873-5300
Fax 901-873-5301

CENTRAL ARKANSAS
6812 Lindsey Rd.
Little Rock, AR 72206
Phone 501-375-9178
Fax 501-375-4254



MILLINGTON, TN

LITTLE ROCK, AR

MECHANICAL EVALUATION

Mechanical Inspection (cont)

Inspect bolt holes and fasteners. Validate correct fasteners.

Shaft Condition: Good

DE AND ODE SEAL TYPE: —

DE SHAFT EXT.: 1.874

ODE SHAFT EXT.: .981

DE SHAFT EXT. KEYWAY: .499

ODE SHAFT EXT. KEYWAY: .312

DE SHAFT AIR SEAL (inner): 2.501

ODE SHAFT AIR SEAL (inner): 2.338

(Outer): 2.164

(Outer): 1.924

DE SHAFT BRG JOURNAL : 2.1658

ODE SHAFT BRG JOURNAL : 1.9689

If journal is undersize,amount: 000

If journal is undersize,amount: 000

DE BEARING SEAT: Good

ODE BEARING SEAT: Good

Shaft damage cause: None

REPAIR OR REPLACE SHAFT:

ANY OTHER SHAFT DAMAGE NOT
PREVIOUSLY MENTIONED:

WEST TENNESSEE

7030 Ryburn Drive
Millington, TN 38053
Phone 901-873-5300
Fax 901-873-5301

CENTRAL ARKANSAS

6812 Lindsey Rd.
Little Rock, AR 72206
Phone 501-375-9178
Fax 501-375-4254



MILLINGTON, TN

LITTLE ROCK, AR

MECHANICAL EVALUATION

Mechanical Inspection (Continued)

DE Endbell fits/damage: Good

ODE Endbell fits/damage: Good

DE END BELL BRG FIT: 4.7244

ODE END BELL BRG FIT: 4.3307

DE END BELL AIR SEAL: 2.173

ODE END BELL AIR SEAL: 1.983

Endbell DE insulated?: No

Endbell ODE insulated?: No

Bushings/sleeves DE: Ok

Bushings/sleeves ODE: Ok

Does Air Gap Meet Customer or EASA spec(<10% variation)?

Yes

WEST TENNESSEE

7030 Ryburn Drive
Millington, TN 38053
Phone 901-873-5300
Fax 901-873-5301

CENTRAL ARKANSAS

6812 Lindsey Rd.
Little Rock, AR 72206
Phone 501-375-9178
Fax 501-375-4254



MILLINGTON, TN

LITTLE ROCK, AR

MECHANICAL EVALUATION

Conclusion

LIST MACHINE WORK
REQUIRED :

None req'd

All fits are within tolerances

Service Tech name: Billy mays

WEST TENNESSEE

7030 Ryburn Drive
Millington, TN 38053
Phone 901-873-5300
Fax 901-873-5301

CENTRAL ARKANSAS

6812 Lindsey Rd.
Little Rock, AR 72206
Phone 501-375-9178
Fax 501-375-4254