



4/12/2021 7:38:53 AM

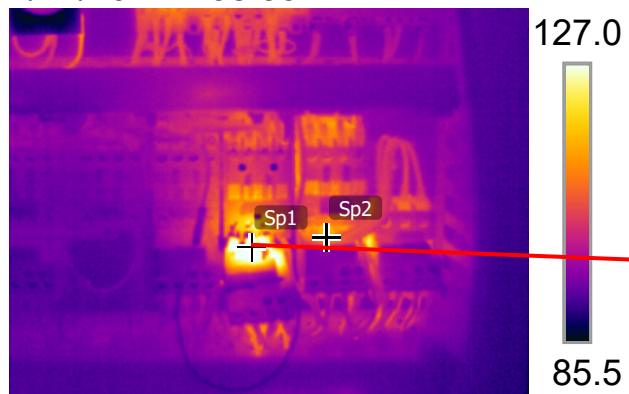

IR_1789.jpg S60 NTSC 21801575

4/12/2021 7:39:01 AM

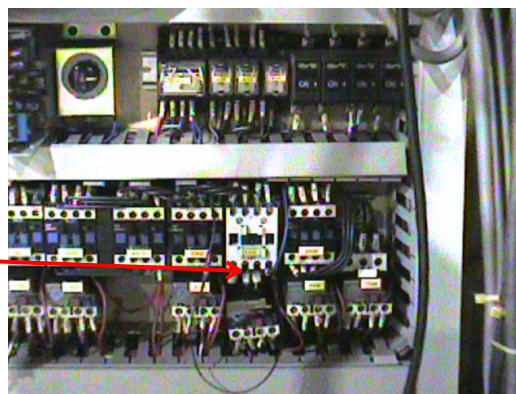

DC_1790.jpg

Measurements

Sp1	150.9 °F
Sp2	109.9 °F

Parameters

Emissivity	0.95
Refl. temp.	49 °F

Asset #1127

Infrared data indicates high resistance connections between the starter and the overloads. inspect overloads and the connections between the starter and overloads. Make sure the overloads match same brand and model as the starter.