



4/12/2021 7:06:53 AM

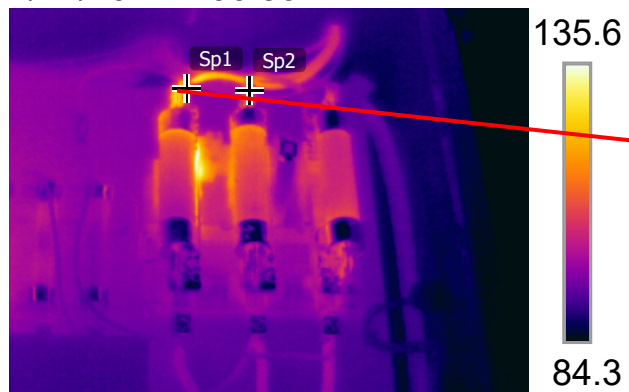

IR_1775.jpg S60 NTSC 21801575

4/12/2021 7:07:01 AM

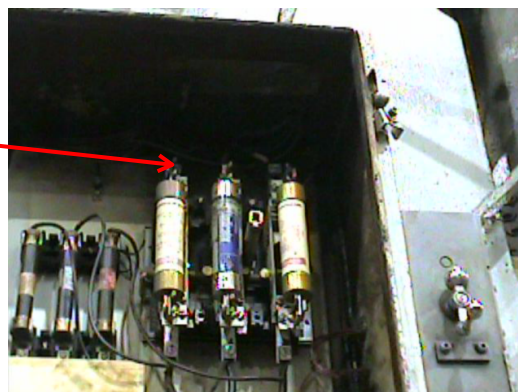

DC_1776.jpg

Measurements

Sp1	130.9 °F
Sp2	108.2 °F

Parameters

Emissivity	0.95
Refl. temp.	49 °F

Asset # 2612

Infrared data indicates a high resistance connection on the load side of phase A. there is a 22.7* delta T between phase A and phase B. Clean wire and terminal .Tighten to manufacture recommend tourqe specs. Clean the fuse holder and the fuse with sand paper.