



MILLINGTON, TN

LITTLE ROCK, AR

Job Information

Job #: 94361

Date: June 7, 2018

Priority: —

Authorized OT: No

Authorized by:

Customer Information

Name: Bryce

Motor#:

Name Plate Information

Manufacturer: Lenses

Enclosure : Open Drop Proof
(ODP)

Serial#: 80786-AU

Model#:

Service Factor:

Frame: 328AT

Horsepower/kW: 60

Rated RPM: 1750

Armature

Volts 500

Amps 105

Fields

Volts 300

Amps 1.9

Mechanical Inspection

Inspect bolt holes and fasteners. Validate correct fasteners.

Bearings DE: Worn

Bearings DE make: NTN

Insulated: No

Bearing DE Size: 63211/C3

Bearings ODE: Worn

Bearings ODE make: NTN

Bearing Type: Ball

Bearing ODE Size: 63210/C3

Bearings Retainer: No

Thermal Protection: Yes

Retainer condition: —

Thermal Protection Type: —

WEST TENNESSEE

7030 Ryburn Drive
Millington, TN 38053
Phone 901-873-5300
Fax 901-873-5301


CENTRAL ARKANSAS

6812 Lindsey Rd.
Little Rock, AR 72206
Phone 501-375-9178
Fax 501-375-4254

Mechanical Inspection (Continued)

Seals DE type: N/A

Seals Image:

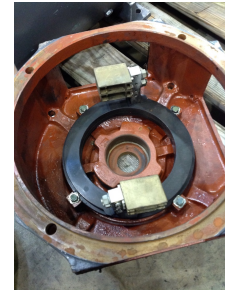

Seals DE size:

Seals DE (inbound)
condition :

Seals ODE condition : None

Seals Image 2:



Seals ODE type: N/A

Seals ODE size:

Seals ODE (inbound)
condition :

Lubrication Type: Grease

Thermal Protection device DE: N/A

Lubrication brand inbound: Mobile Polyrex EM

Thermal Protection device ODE: N/A

Lubrication brand
outbound: Mobile Polyrex EM

Grease Amt DE: N/A

Grease Cond. DE: Other

Grease Amt ODE: N/A

Grease Cond. ODE: Other

Seals DE condition : None



MILLINGTON, TN

LITTLE ROCK, AR

Mechanical Inspection (Continued)

Brg. Seats DE: Good

Shaft damage: OK

If DE undersized, amt.:

Shaft damage cause: None

Brg. Seats ODE: Good

Bushings/sleeves DE: Ok

If ODE undersized, amt.:

Bushings/sleeves ODE: Ok

Endbell fits/damage: Good

Endbell type: Single piece

Endbell DE size: 3.9374

Endbell ODE size: 3.5437

Endbell DE insulated?: No

Endbell ODE insulated?: No

Conclusion

Service Tech name: Terrence Holland

Service Tech signature: