



8/11/2021 7:41:03 AM

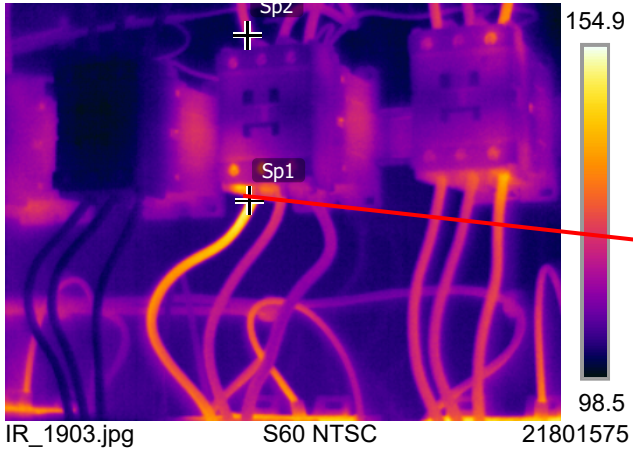

8/11/2021 7:41:13 AM

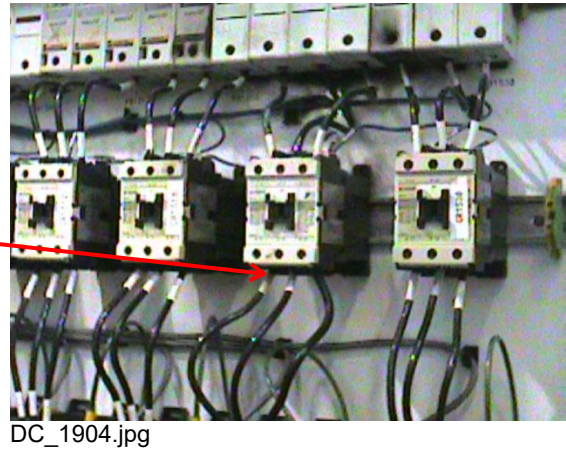

Measurements

Sp1	155.2 °F
Sp2	121.3 °F

Parameters

Emissivity	0.95
Refl. temp.	49 °F

Infrared data indicate a high resistance connection on the load side of phase A. Check the wire for damage. Replace if necessary, and repair as necessary tighten to proper torque.